

TECH LIBRARY KAFB, NM
0144956

RECEIVED AAFLD
AFMPC

NATIONAL ADVISORY COMMITTEE
FOR AERONAUTICS 10:07

TECHNICAL NOTE

No. 1636

DETERMINATION OF STRESSES IN GAS-TURBINE DISKS
SUBJECTED TO PLASTIC FLOW AND CREEP

By M. B. Millenson and S. S. Manson

Flight Propulsion Research Laboratory
Cleveland, Ohio



Washington
June 1948

AFMPC
TECHNICAL LIBRARY
AFMPC

739/
8122



NATIONAL ADVISORY COMMITTEE FOR AERONAUTICS

TECHNICAL NOTE NO. 1636

DETERMINATION OF STRESSES IN GAS-TURBINE DISKS

SUBJECTED TO PLASTIC FLOW AND CREEP

By M. B. Millenson and S. S. Manson

SUMMARY

A finite-difference method previously presented for computing elastic stresses in rotating disks is extended to include the computation of the disk stresses when plastic flow and creep are considered. A finite-difference method is employed to eliminate numerical integration and to permit nontechnical personnel to make the calculations with a minimum of engineering supervision. Illustrative examples are included to facilitate explanation of the procedure by carrying out the computations on a typical gas-turbine disk through a complete running cycle.

The results of the numerical examples presented indicate qualitatively that plastic flow markedly alters the elastic-stress distribution and that, if the amount of creep is small, the effect on stress distribution is also small.

INTRODUCTION

With the advent of jet propulsion as a motive force for aircraft, the gas turbine has become an important source of power. In most machinery, design stresses are limited by the yield strength or the creep strength of the material employed, together with a certain factor of safety, and little or no analytical consideration is given to the occurrence of plastic flow under operating conditions. Gas-turbine disks, however, are required to operate under thermal gradients and centrifugal forces producing stresses that, in materials currently available, frequently exceed the yield strength, resulting in plastic flow. The interaction of plastic flow and creep, together with the variation of thermal gradients through a series of cycles consisting in starting, running, and stopping can produce stress distributions and even failures that might not be suspected on a basis of elastic-stress analysis.

A rapid routine method of elastic-stress analysis of rotating disks is presented in reference 1, which gives accurate values of the true stresses in disks, provided that the yield strength of the

material is not exceeded. The finite-difference method of reference 1 has been extended at the NACA Cleveland laboratory to include consideration of plastic flow and creep, which thus allows calculation of the true stresses in a gas-turbine disk and gives the variation of stress distribution with time. The handling of plastic flow is somewhat less routine than the calculation of the elastic stresses in that a repetitive trial procedure is required. With practice, the correct value can be obtained on the fourth or fifth trial. The computation of the effect of creep, although in procedure the same as the computation of plastic flow, is a direct calculation requiring no trial-and-error procedures. Because the method eliminates numerical integration, nontechnical personnel can make the calculations with a minimum of engineering supervision.

SYMBOLS

The following symbols are used:

- c creep rate under stress σ_e , inches per inch per hour
- E elastic modulus of disk material, pounds per square inch
- h axial thickness of disk, inches
- R ratio $\left(\frac{3 \epsilon_p}{2 \sigma_e} \right)$
- r radial distance, inches
- T temperature, $^{\circ}\text{F}$
- u radial displacement, inches
- α coefficient of thermal expansion between actual temperature and temperature at which there is zero thermal stress, inches per inch per $^{\circ}\text{F}$
- Γ total creep under stress σ_e , inches per inch
- Δ plastic increment of strain, inches per inch
- Δ_r plastic increment of strain in radial direction
- Δ_t plastic increment of strain in tangential direction
- ΔT temperature increment above temperature of zero thermal stress, $^{\circ}\text{F}$

δ_r	creep increment in radial direction, inches per inch
δ_t	creep increment in tangential direction, inches per inch
ϵ	strain, inches per inch
ϵ_p	plastic strain corresponding to stress σ_e in tensile specimen, inches per inch
ϵ_r	radial strain, inches per inch
ϵ_t	tangential strain, inches per inch
μ	Poisson's ratio
ρ	mass density of disk material, pound second ² per inch ⁴
σ	stress, pounds per square inch
σ_e	equivalent tensile stress, pounds per square inch
σ_r	radial stress, pounds per square inch
σ_t	tangential stress, pounds per square inch
σ_y	proportional elastic limit, pounds per square inch
τ	time during which creep occurs, hours
ω	angular velocity, radians per second

The following supplementary subscripts are used for denoting values of the preceding symbols in connection with the finite-difference solution:

n	n^{th} point station
$n-1$	$(n-1)^{\text{th}}$ point station
a	station at smallest disk radius considered (For disk with a central hole, this station is taken at the radius of hole; for a solid disk this station is taken at a radius approximately 5 percent of the rim radius.)
b	station at rim of disk or base of blades

The following supplementary symbols denote combinations of the foregoing symbols:

$$\left. \begin{array}{l} A_{r,n} \\ A_{t,n} \\ B_{r,n} \\ B_{t,n} \end{array} \right\} \begin{array}{l} \text{stress coefficients defined by equations} \\ \\ \sigma_{r,n} = A_{r,n} \sigma_{t,a} + B_{r,n} \\ \sigma_{t,n} = A_{t,n} \sigma_{t,a} + B_{t,n} \end{array}$$

$$C_n = r_n h_n$$

$$C'_n = \frac{\mu_n}{E_n} + \frac{(1 + \mu_n)(r_n - r_{n-1})}{2 E_n r_n}$$

$$D_n = \frac{1}{2} (r_n - r_{n-1}) h_n$$

$$D'_n = \frac{1}{E_n} + \frac{(1 + \mu_n)(r_n - r_{n-1})}{2 E_n r_n}$$

$$F_n = r_{n-1} h_{n-1}$$

$$F'_n = \frac{\mu_{n-1}}{E_{n-1}} - \frac{(1 + \mu_{n-1})(r_n - r_{n-1})}{2 E_{n-1} r_{n-1}}$$

$$G_n = \frac{1}{2} (r_n - r_{n-1}) h_{n-1}$$

$$G'_n = \frac{1}{E_{n-1}} - \frac{(1 + \mu_{n-1})(r_n - r_{n-1})}{2 E_{n-1} r_{n-1}}$$

$$H_n = \frac{1}{2} \omega^2 (r_n - r_{n-1}) (\rho_n h_n r_n^2 + \rho_{n-1} h_{n-1} r_{n-1}^2)$$

$$H'_n = \alpha_n \Delta T_n - \alpha_{n-1} \Delta T_{n-1}$$

$$K_n = \frac{F'_n D_n - F_n D'_n}{C'_n D_n - C_n D'_n}$$

$$K'_n = \frac{C_n F'_n - C'_n F_n}{C'_n D_n - C_n D'_n}$$

$$L_n = - \frac{G'_n D_n + G_n D'_n}{C'_n D_n - C_n D'_n}$$

$$L'_n = - \frac{C'_n G_n + C_n G'_n}{C'_n D_n - C_n D'_n}$$

$$M_n = \frac{D'_n H_n + D_n (H'_n - P'_n - Q'_n)}{C'_n D_n - C_n D'_n}$$

$$M'_n = \frac{C'_n H_n + C_n (H'_n - P'_n - Q'_n)}{C'_n D_n - C_n D'_n}$$

(M_n and M'_n are defined in reference 1 for the special case $P'_n = Q'_n = 0$)

$$P'_n = \Delta_{r,n} \left(\frac{r_n - r_{n-1}}{2 r_n} \right) + \Delta_{r,n-1} \left(\frac{r_n - r_{n-1}}{2 r_{n-1}} \right) - \Delta_{t,n} \left(1 + \frac{r_n - r_{n-1}}{2 r_n} \right) \\ + \Delta_{t,n-1} \left(1 - \frac{r_n - r_{n-1}}{2 r_{n-1}} \right)$$

$$Q'_n = \delta_{r,n} \left(\frac{r_n - r_{n-1}}{2 r_n} \right) + \delta_{r,n-1} \left(\frac{r_n - r_{n-1}}{2 r_{n-1}} \right) - \delta_{t,n} \left(1 + \frac{r_n - r_{n-1}}{2 r_n} \right) \\ + \delta_{t,n-1} \left(1 - \frac{r_n - r_{n-1}}{2 r_{n-1}} \right)$$

ANALYSIS OF PLASTIC FLOW AND CREEP

Assumptions. - Four assumptions are made in the subsequent analysis:

1. The disk material is linearly elastic up to a limiting stress value, called the proportional elastic limit, and above this limit plastic flow occurs.

2. All variables of material properties and operating conditions are symmetrical about the axis of rotation.

3. Axial stresses may be neglected and the radial and tangential stresses are uniform across the thickness of the disk.

4. Temperatures are uniform across the thickness of the disk.

Outline of method. - In any thin, rotating disk, the complete stress state is defined when the two principal stresses, radial σ_r and tangential σ_t , are known at every radius. Two equations relating these stresses to the radius are required to specify the stress distribution. The first of these equations can be determined from the conditions of equilibrium of an element of the disk and involves no elastic properties of the material. The second is derived from the compatibility conditions, which state the interrelation of radial and tangential strains. The compatibility conditions are dependent upon stress-strain phenomena and must therefore include any departure from linear elasticity. When modification to allow for any possible departure from Hooke's law is made, the compatibility conditions become true for any value of stress. The equation derived from the compatibility conditions thus modified, together with the equilibrium equation, is treated by the finite-difference method of reference 1, and similar equations are obtained. These equations result in additional terms in the final equations, which are used to modify the result of the elastic calculation.

Whenever stresses under discussion have been calculated by the method of reference 1 only, they will be referred to as "elastic stresses"; where plastic flow and creep have been taken into account, the stresses will be referred to as "plastic stresses."

Derivation of method. - The equilibrium equation, which applies to both the elastic and plastic conditions, is

$$\frac{d}{dr} (r h \sigma_r) - h \sigma_t + \rho \omega^2 r^2 h = 0 \quad (1)$$

The elastic compatibility relations given in terms of the radial displacement are

$$\epsilon_r = \frac{du}{dr} = \frac{\sigma_r - \mu \sigma_t}{E} + \alpha \Delta T \quad (2)$$

and

$$\epsilon_t = \frac{u}{r} = \frac{\sigma_t - \mu \sigma_r}{E} + \alpha \Delta T \quad (3)$$

Equations (2) and (3) must be modified to include consideration of plastic flow. When a material is stressed beyond the proportional elastic limit, the strain in the material is different from that indicated by Hooke's law. The strain under such a load may be considered as being made up of two components, one elastic as predicted by the laws of elasticity and one an increment of strain due to the flow that occurs. Rewriting equations (2) and (3) on this basis gives

$$\epsilon_r = \frac{du}{dr} = \frac{\sigma_r - \mu \sigma_t}{E} + \alpha \Delta T + \Delta_r \quad (4)$$

$$\epsilon_t = \frac{u}{r} = \frac{\sigma_t - \mu \sigma_r}{E} + \alpha \Delta T + \Delta_t \quad (5)$$

Similarly, any creep that occurs represents an additional departure from elastic behavior, which further modifies equations (2) and (3) to

$$\epsilon_r = \frac{du}{dr} = \frac{\sigma_r - \mu \sigma_t}{E} + \alpha \Delta T + \Delta_r + \delta_r \quad (6)$$

$$\epsilon_t = \frac{u}{r} = \frac{\sigma_t - \mu \sigma_r}{E} + \alpha \Delta T + \Delta_t + \delta_t \quad (7)$$

When the parameter u is eliminated as in reference 1,

$$\frac{d}{dr} \left(\frac{1}{E} \sigma_t - \frac{\mu}{E} \sigma_r + \alpha \Delta T + \Delta_t + \delta_t \right) = \frac{1+\mu}{Er} (\sigma_r - \sigma_t) + \frac{\Delta_r - \Delta_t}{r} + \frac{\delta_r - \delta_t}{r} \quad (8)$$

Applying the finite-difference method to equations (1) and (8) and using the notation introduced in the section entitled "SYMBOLS" gives

$$C_n \sigma_{r,n} - D_n \sigma_{t,n} = F_n \sigma_{r,n-1} + G_n \sigma_{t,n-1} - H_n \quad (9)$$

and

$$C'_n \sigma_{r,n} - D'_n \sigma_{t,n} = F'_n \sigma_{r,n-1} - G'_n \sigma_{t,n-1} + H'_n - P'_n - Q'_n \quad (10)$$

The solution of the equations is facilitated by the substitution of the stress coefficients $A_{r,n}$, $A_{t,n}$, $B_{r,n}$, and $B_{t,n}$ into equations (9) and (10). Proceeding as in reference 1 results in the equations

$$\left. \begin{aligned} C_n A_{r,n} - D_n A_{t,n} - F_n A_{r,n-1} - G_n A_{t,n-1} &= 0 \\ C'_n A_{r,n} - D'_n A_{t,n} - F'_n A_{r,n-1} + G'_n A_{t,n-1} &= 0 \\ C_n B_{r,n} - D_n B_{t,n} - F_n B_{r,n-1} - G_n B_{t,n-1} + H_n &= 0 \\ C'_n B_{r,n} - D'_n B_{t,n} - F'_n B_{r,n-1} + G'_n B_{t,n-1} - H'_n + P'_n + Q'_n &= 0 \end{aligned} \right\} \quad (11)$$

All but the last of equations (11) and equations (15) of reference 1 are identical. When equations (11) are solved for $A_{r,n}$, $A_{t,n}$, $B_{r,n}$, and $B_{t,n}$,

$$\left. \begin{aligned} A_{r,n} &= K_n A_{r,n-1} + L_n A_{t,n-1} \\ A_{t,n} &= K'_n A_{r,n-1} + L'_n A_{t,n-1} \\ B_{r,n} &= K_n B_{r,n-1} + L_n B_{t,n-1} + M_n \\ B_{t,n} &= K'_n B_{r,n-1} + L'_n B_{t,n-1} + M'_n \end{aligned} \right\} \quad (12)$$

The symbols K_n , K'_n , L_n , and L'_n have the same meaning as in reference 1. The M_n and M'_n terms are now defined as

$$M_n = \frac{D'_n H_n + D_n (H'_n - P'_n - Q'_n)}{C'_n D_n - C_n D'_n} \quad (13)$$

$$M'_n = \frac{C'_n H_n + C_n (H'_n - P'_n - Q'_n)}{C'_n D_n - C_n D'_n} \quad (13a)$$

The elastic case of reference 1 thus becomes a special case of the more general problem in which P'_n and Q'_n are both zero.

Evaluation of plastic terms. - In order to apply the finite-difference method to problems involving plastic flow, a relation between stresses and strains in the plastic region must be established. In reference 2, a numerical-integration method for computing disk stresses is presented in which elongation is assumed to proceed at constant stress when the proportional limit is reached. References 3 and 4 present equations for the plastic relation of stress to strain based on the maximum distortion theory. Relations can be derived from the equations given in reference 4, which form a convenient means of finding the plastic increments corresponding to the stresses present in the disk. Rewriting these equations in the notation of this report and letting the subscripts 1, 2, and 3 denote the three principal directions in the most general case gives

$$\left. \begin{aligned} \Delta_1 &= \frac{R}{3} [(\sigma_1 - \sigma_2) + (\sigma_1 - \sigma_3)] \\ \Delta_2 &= \frac{R}{3} [(\sigma_2 - \sigma_1) + (\sigma_2 - \sigma_3)] \\ \Delta_3 &= \frac{R}{3} [(\sigma_3 - \sigma_1) + (\sigma_3 - \sigma_2)] \end{aligned} \right\} \quad (14)$$

$$\sigma_e = \frac{1}{\sqrt{2}} \sqrt{(\sigma_1 - \sigma_2)^2 + (\sigma_2 - \sigma_3)^2 + (\sigma_3 - \sigma_1)^2} \quad (15)$$

where the ratio R is defined in terms of the corresponding uniaxial stress σ_e and plastic strain ϵ_p in a tensile specimen by the relation

$$R = \frac{3\epsilon_p}{2\sigma_e} \quad (16)$$

When equations (14), (15), and (16) are reduced to the biaxial condition, which is assumed to prevail in the disk (that is, $\sigma_3 = 0$), and the finite-difference notation is introduced

$$\left. \begin{aligned} \Delta_{r,n} &= \frac{R}{3} (\sigma_{r,n} - \sigma_{t,n} + \sigma_{r,n}) \\ \Delta_{t,n} &= \frac{R}{3} (\sigma_{t,n} - \sigma_{r,n} + \sigma_{t,n}) \end{aligned} \right\} \quad (17)$$

$$\sigma_{e,n} = \sqrt{\sigma_{r,n}^2 - \sigma_{r,n} \sigma_{t,n} + \sigma_{t,n}^2} \quad (18)$$

and

$$R = \frac{3 \epsilon_{p,n}}{2 \sigma_{e,n}} \quad (19)$$

Substituting equation (19) into equations (17) gives

$$\left. \begin{aligned} \Delta_{r,n} &= \frac{\epsilon_{p,n}}{2 \sigma_{e,n}} (2 \sigma_{r,n} - \sigma_{t,n}) \\ \Delta_{t,n} &= \frac{\epsilon_{p,n}}{2 \sigma_{e,n}} (2 \sigma_{t,n} - \sigma_{r,n}) \end{aligned} \right\} \quad (20)$$

A typical uniaxial stress-strain curve illustrating the relation between effective stress $\sigma_{e,n}$ and effective plastic strain $\epsilon_{p,n}$ on such a curve is shown in figure 1. Investigations at the National Physical Laboratory of Great Britain on turbine-disk alloys and experiments by Taylor and Quinney (reference 5) were found to correlate well with equations (20) for the range of strains over which the volume of the material is approximately constant.

Equations (20) give the relations between plastic strains and true stresses that will be used as the basis for numerical calculations in the present report. The method of stress analysis to be presented does not depend, however, on the validity of these equations. As more accurate relations are determined between stresses and strains, these relations may readily be used in place of equations (20).

Calculation of plastic flow when no previous plastic flow has occurred. - The determination of the plastic stresses in the disk resolves itself into the problem of finding corresponding stresses and strains that satisfy equilibrium and compatibility equations (9) and (10), and biaxial stress-strain equations (20). The problem is approached by first computing the elastic stresses, and the equivalent uniaxial tensile stress at each station is determined from

equation (18). If at any station this stress exceeds the proportional elastic limit of the material at the temperature at this station, then plastic flow takes place, and it becomes necessary to resort to a trial-and-error procedure to adjust the stresses to allow for this flow.

Assume, for example, the equivalent uniaxial stress at a given station lies at point A on the extension of the modulus line in figure 2. Because the point A lies above the proportional elastic limit (point B), plastic flow must occur. The stress and strain must be adjusted to fall on the curved stress-strain curve that is characteristic of the material. As a starting point, the total strain in the true stress-strain condition is assumed equal to the strain at A. The stress-strain condition at the given station then lies on the constant-strain line through B, or at C. The plastic strain $\epsilon_{p,n}$ is given by CD. Values of Δr_n , Δt_n , and P'_n may be obtained by using this value of $\epsilon_{p,n}$, together with the values of $\sigma_{r,n}$, $\sigma_{t,n}$, and $\sigma_{e,n}$ from the elastic calculations.

Once P'_n has been calculated, new values of $\sigma_{r,n}$, $\sigma_{t,n}$, and $\sigma_{e,n}$ can be computed. The new value of $\sigma_{e,n}$ is greater than that at point D, such as that at point E. Although the stresses corresponding to $\sigma_{e,n}$ at point E together with the strain CD meet the conditions of equations (9) and (10), they locate the stress-strain point F, which is not on the stress-strain curve, so that the physical conditions imposed by the material are as yet unsatisfied. Inasmuch as any value of $\epsilon_{p,n}$ less than CD would give a value of $\sigma_{e,n}$ greater than that at E, CD is a lower limit of $\epsilon_{p,n}$. Similarly, because the value of $\sigma_{e,n}$ calculated by using an $\epsilon_{p,n}$ of CD is too great, the increment of strain EG corresponding to this $\sigma_{e,n}$ is an upper limit of $\epsilon_{p,n}$. Inasmuch as the true value of $\epsilon_{p,n}$ lies between CD and EG, their numerical average, shown as HK, is assumed to be a good approximation. New values of P'_n , $\sigma_{r,n}$, $\sigma_{t,n}$, and $\sigma_{e,n}$ can be computed by using HK for $\epsilon_{p,n}$, the stress at E for $\sigma_{e,n}$, and $\sigma_{r,n}$ and $\sigma_{t,n}$. Suppose this new value of $\sigma_{e,n}$ lies at the point M. Because the stress at M is higher than the stress at E in value, the increment HK is too small a value for $\epsilon_{p,n}$ and is therefore established as a new lower limit of $\epsilon_{p,n}$. Further, because M is less than E, the corresponding increment MN is a new upper limit for $\epsilon_{p,n}$ and the process could be repeated again with the numerical average of MN and HK. Similarly, if the calculation using an $\epsilon_{p,n}$ of HK had resulted in a $\sigma_{e,n}$ at P, HK would constitute a new upper limit and PQ a new lower limit. Had the resulting $\sigma_{e,n}$ been at R, HK would

have still become the new upper limit of $\epsilon_{p,n}$, but CD would have remained as the lower limit. The process is repeated until the value of $\epsilon_{p,n}$ used in the computation and the $\epsilon_{p,n}$ corresponding to the resulting $\sigma_{e,n}$ are equal.

Calculation of plastic flow when previous plastic flow has occurred. - The equations for strain that would apply to a disk that had already undergone the plastic strain are

$$\epsilon_r = \frac{\sigma_r - \mu\sigma_t}{E} + \alpha\Delta T + [\Delta_r] + \Delta_r \quad (21)$$

$$\epsilon_t = \frac{\sigma_t - \mu\sigma_r}{E} + \alpha\Delta T + [\Delta_t] + \Delta_t \quad (21a)$$

Here the terms $[\Delta_r]$ and $[\Delta_t]$ represent strains already existent in the material before the application of stresses σ_t and σ_r and are constant for the calculation, whereas Δ_r and Δ_t represent the components of plastic strain resulting from the application of σ_r and σ_t . In the solution of the equations by the finite-difference method, a term $[P'_n]$ appears together with term P'_n . When previous plastic flow has occurred only once, $[P'_n]$ is identical with P'_n from the previous calculation; where plastic flow has previously occurred more than once, $[P'_n]$ is the algebraic sum of all earlier P'_n terms. Thus, the previous plastic flow given by $[P'_n]$ may be grouped with the temperature-effect term H'_n by replacing H'_n with $H'_n - [P'_n]$.

This procedure amounts to an assumption that, as the load and the temperature change, the stress position on the new stress-strain curve would be the same as if a test specimen were loaded above the yield point, the load removed, the temperature changed, and a new load applied. This assumption is illustrated by figure 3, in which point A represents a loading at the first temperature condition; the dotted line AB represents the load-removal path; the curve BCD, the stress-strain curve at the new temperature; and point C, the new stress position. The total strain at this point C is given by the sum of three strains. The residual strain caused by the first loading is ϵ_1 ; ϵ_2 is the elastic part of the strain caused by the second loading; and ϵ_3 , the plastic strain caused by the second loading.

When the foregoing procedure is applied, the curve BCD must, of course, represent the true stress-strain curve at the new temperature of a material that has already been subjected to the plastic

cycle OAB. In general, the new stress-strain curve is different from the stress-strain curve at the given temperature of a material that has not been subjected to plastic flow; however, unless data are available it may be necessary to assume that the curve BCD is the stress-strain curve at the given temperature of a specimen of virgin material.

Calculation of effect of creep. - Creep is usually defined as the continuous deformation of material under a continuously applied load. Experimental data on creep of various materials are usually obtained from tests run under constant load and temperature, although in many engineering applications of materials the more general problem of changing load and temperature must be considered. The deformation curve obtained in a typical test is shown in figure 4. From this figure it can be seen that the deformation may be considered as having occurred in three stages. During the primary stage, the deformation proceeds at a decreasing rate; during the secondary stage, at a constant rate; and during the tertiary stage, at an increasing rate, which proceeds until failure occurs.

Because of the lack of data on creep except for uniaxial tensile stress, a relation between creep deformation and stress must be assumed. The following equations have been used for calculations in this report but, as better data become available, more accurate relations can be used. By the use of reasoning similar to that employed in determining the biaxial components of plastic-strain formulas for the creep increments, $\delta_{r,n}$ and $\delta_{t,n}$ may be written

$$\delta_{r,n} = \frac{\Gamma_n}{2 \sigma_{e,n}} (2 \sigma_{r,n} - \sigma_{t,n}) \quad (22)$$

$$\delta_{t,n} = \frac{\Gamma_n}{2 \sigma_{e,n}} (2 \sigma_{t,n} - \sigma_{r,n}) \quad (22a)$$

In equations (22) and (22a), Γ_n represents the total creep that would occur in time τ under the uniaxial stress $\sigma_{e,n}$. It is here assumed that for sufficiently small values of τ the creep may be considered as occurring instantaneously at the end of the time period.

During the secondary stage of creep, a characteristic creep rate c_n exists, corresponding to the stress $\sigma_{e,n}$ at temperature T , and Γ_n is given directly by

$$\Gamma_n = c_n \tau \quad (23)$$

This rate is the value usually published in papers on creep and is the rate used for the numerical calculations of this report. During primary and tertiary creep stages, the creep rate is also a function of time, but does not otherwise complicate the computation.

Once values of $\delta_{r,n}$ and $\delta_{t,n}$ have been found, the values of the Q'_n terms may be determined and new values of $\sigma_{r,n}$ and $\sigma_{t,n}$ may be computed. If the computed values of $\sigma_{r,n}$ and $\sigma_{t,n}$ differ by more than a small amount, perhaps 2 percent, from the values of these stresses before creep occurred, a shorter time interval should be selected and additional computations made for each such time interval required to equal the total time during which creep occurs. The effect of creep that occurred at previous time intervals is considered in a manner similar to that employed in considering previous plastic flow. The successive values of Q'_n are summed to form a term $[Q'_n]$, which gives the total effect of all previous creep deformation so that the term

$$H'_n - [P'_n]$$

is replaced by

$$H'_n - [P'_n] - [Q'_n]$$

In any calculation of stress distribution subsequent to the occurrence of creep, the creep term $[Q'_n]$ is combined with the term $[P'_n]$ as the cumulative effect of all previous plastic deformation.

Examples showing in detail how successive stages of plastic flow and creep are computed, each stage considering all previous plastic deformation, are given in the section entitled "NUMERICAL EXAMPLES."

NUMERICAL EXAMPLES

The numerical examples presented here represent a set of computations during one complete start-run-stop cycle for a typical turbine disk with a continuous rim and welded blades. The assumed profile of the disk is shown in figure 5, together with the locations of the point stations used in the computations. The assumed temperature distributions and corresponding turbine rotative speeds are shown in figure 6. Curve IV and the corresponding speed of 11,500 rpm represent the steady-state running condition. Curves I to III and the corresponding speeds represent running

conditions through which the turbine disk passes in reaching steady-state operation. Curves V to VII together with the respective speeds represent running conditions through which the turbine disk passes when being stopped. Creep is assumed to occur only during the steady-state running period.

The physical properties of the disk material, including specific gravity, modulus of elasticity, stress-strain characteristics, and thermal coefficients of expansion, were based on the data appearing in references 6 and 7, together with unpublished data obtained from the author of these references. The stress-strain curves were constructed on the basis of these data and those for example I appear in figure 7. Inasmuch as no data were available on the effect of previous plastic flow on the shape of the stress-strain curves, it was necessary to ignore such effects and to use curves obtained directly from simple tensile-test data. The creep properties used in the computations were assumed, but they correspond approximately to the secondary creep rates given in reference 8. The effect of primary creep was omitted because of lack of data.

Because the disk used for these calculations is solid at the center, a supplementary numerical example showing the computation of the plastic-flow effect on stress distribution in a disk containing a central hole is given in the appendix.

Example I. - Example I is the calculation of the stress distribution in a disk operating under the conditions of curve I of figure 6 and having been subjected to no previous plastic deformation. These conditions are assumed to represent disk operation after the first short period of steady combustion, when gas temperatures are high, thereby establishing a steep temperature gradient between the center and the rim of the disk.

The preliminary elastic calculation is carried out in table I(a) by the method of reference 1. Two changes are made in the tabular setup. The first change is the insertion of columns 25a and 25b immediately following column 25. Column 25a lists the accumulated values of $[P'_n]$ and $[Q'_n]$, the total effect of previous plastic deformation. For the present example, this column is zero for all stations. Column 25b is the value of the term $H'_n - [P'_n] - [Q'_n]$, which in this example is the same as column 25. The second change is the computation of M_n and M'_n (columns 31 and 32), which were computed in reference 1 by the use of column 25. In the present computations, column 25b is used. In addition, two more columns, 40 and 41, are added. Column 40 lists the values of the proportional elastic limit $\sigma_{y,n}$ of the material

and column 41 lists the values of $\sigma_{e,n}$ as computed from equation (18). The entries in columns 40 and 41 of table I(a) show that the equivalent stress $\sigma_{e,n}$ is less than $\sigma_{y,n}$ for all point stations except 17 to b. The effect of plastic flow must be considered at these stations and flow at these stations modifies the stresses at other locations in the disk. With the exceptions and the additions noted, the method of computation is the same as the method of reference 1 and will not be discussed in further detail.

The plastic-flow calculation has been divided into two parts because several quantities used in the computation depend only on the dimensions of the disk and can be used in all subsequent calculations involving plastic deformation. These quantities are computed for stations 17 to b as shown by the four column headings of table I(b).

The second part of the plastic-flow calculation is given in table I(c). The first column in this part of the table (column 46) lists the values of $\epsilon_{p,n}$ obtained from the corresponding stress-strain curve (fig. 7) as explained previously. Column 46a lists the value of $\epsilon_{p,n}$ used for the ensuing calculation, which for the first approximation is the same as column 46. Columns 47 and 48 list the values of $\Delta_{r,n}$ and $\Delta_{t,n}$, respectively, computed by equations (20). Columns 49 to 52 are computed as shown by the column headings and from these columns the values of P'_n are computed and listed in column 53. Column 54 gives the values of the term $H'_n - [P'_n] - [Q'_n] - P'_n$, which is then used to compute new values of M_n ; M'_n , $B_{r,n}$, $B_{t,n}$, $\sigma_{t,a}$, $\sigma_{r,n}$, $\sigma_{t,n}$, and $Q_{\theta,n}$ as shown in columns 55 to 62, respectively. The new values of $\epsilon_{p,n}$ corresponding to the new values of $\sigma_{e,n}$ are read from figure 7 and listed in column 46 of the second-approximation calculation. The values in column 46 for the first and second approximations now constitute the lower and upper limits, respectively, of the possible strain increments. For the second approximation, column 46a therefore lists as the values of $\epsilon_{p,n}$ to be used in this set of calculations the numerical averages of the two sets of readings from the stress-strain curve. From this value, another new set of stress values is computed and a third set of readings listed in column 46.

At this point in the calculation, two alternate procedures are possible, as shown by consideration of station b. Inasmuch as the average value of 4300×10^{-6} inches per inch used in the second

approximation gave a graph reading of 1900×10^{-6} inches per inch, the averaging procedure would indicate that the next trial should be

$$\frac{4300 + 3960}{2} \times 10^{-6} \quad \text{or} \quad 4130 \times 10^{-6} \text{ inches per inch}$$

This value could be used and the procedure continued until the correct value is found. Considerable time may be saved in making the calculation, however, if a weighted approximation is used. Because the plastic-strain value of 3960×10^{-6} inches per inch gave a resulting reading of 4650×10^{-6} inches per inch whereas the value 4300×10^{-6} inches per inch gave the reading 1900×10^{-6} inches per inch, the strain 3960×10^{-6} inches per inch is apparently more nearly correct than 4300×10^{-6} inches per inch. In addition, the shape of the stress-strain curve in the region of 3960×10^{-6} is such that small increases in stress correspond to large changes in strain. If a trial calculation were made using a value closer to 3960 than 4130 (for instance, 4100), more information might be obtained than would be obtained by the averaging procedure. The right answer is thereby obtained more quickly. The same reasoning might be applied to the selection of values to be used at the other stations for the third calculation. The second of these two procedures has been used in table I(c), as can be seen from the values of $\epsilon_{p,n}$ in column 46a used for the third approximation.

Completion of the third approximation and comparison with new values of strain obtained from the stress-strain curve shows the estimates of the third approximation to be nearly correct, so that small adjustments made to compute the fourth and fifth approximations give the final answers. A calculation equivalent to a sixth approximation is then made to column 53 to get the final correct values of the P'_n terms. The stresses at the other stations a through l6 can now be computed by using the value of $\sigma_{t,a}$ found in the sixth approximation with the values $A_{r,n}$, $A_{t,n}$, $B_{r,n}$, and $B_{t,n}$ found in table I(a). The values of plastic stress at all radii together with the elastic-stress distribution are plotted in figure 8.

Example II. - Example II considers the disk studies in example I at the time that the operating conditions have reached those indicated by curve II of figure 6. The elastic calculations are made by the method of reference 1 modified in accordance with the changes made in example I. The essential parts of the computation are shown in table II, which is abridged from the complete calculation. Column 25a lists the values of $[P'_n]$ that were found as the final values of P'_n in example I. Plastic flow occurs at stations 17, 18, 19, and b, and calculated true stresses when this plastic flow is

considered are listed in table II. The stresses obtained as a result of this computation are plotted in figure 9. The elastic stresses obtained without considering the plastic flow that occurred previously are also plotted for comparison in figure 9.

Example III. - Example III continues the cycle analyzed in examples I and II, at the conditions of curve III of figure 6. Table III gives the essential parts of the calculation for this example, which is similar in procedure to table I. The value of $[P'_n]$, column 25a, however, is the total of the values of P'_n obtained from examples I and II. In this example, plastic flow occurs only at stations 17 and 18. The results of this computation, together with the elastic-stress curves found without consideration of previous plastic flow, are shown in figure 10.

Example IV. - The steady-state operating conditions represented by curve IV of figure 6 are treated in example IV. The essential calculations shown in table IV(a) were made similarly to those in table III except that $[P'_n]$ in column 25a is now the sum of the values of P'_n from examples I, II, and III. Because no values of $\sigma_{e,n}$ exceed those of $\sigma_{y,n}$, no plastic flow occurs and the stress values of table IV(a) are the true stresses at the beginning of steady-state operation. However, as parts of the disk are at elevated temperature, significant creep can occur at steady load at stations 16, 17, and 18, where the stresses are sufficiently high. Table IV(b) shows the calculations of creep. Column 63 lists the creep rate c_n (in./in.)(hr), and column 64 the creep increment Γ_n for the 5-hour running period. Columns 65 and 66 give the computed values of $\delta_{r,n}$ and $\delta_{t,n}$, respectively. The computation then proceeds in a manner similar to the plastic-flow calculations, as indicated in the column headings. The values for stress obtained indicate that, for small values, creep has only a slight effect on the stresses. Figure 11 shows the stress distributions at the beginning and the end of the steady-state running period, together with the elastic stresses obtained without considering either creep or previous plastic flow.

Example V. - The conditions of example V represent one of the conditions through which the turbine disk is assumed to pass during the stopping period. The abridged elastic calculations are given in table V. Values listed now represent the accumulated effect of plastic flow $[P'_n]$ plus the additional effect of the creep represented by $[Q'_n]$; $[Q'_n]$ is the same as the Q'_n computed in example IV. All values of $\sigma_{e,n}$ are less than the corresponding values of $\sigma_{y,n}$; therefore no plastic flow occurs. The results of

the calculation are plotted in figure 12, together with the elastic stresses computed without considering previous plastic flow or creep.

Example VI. - Example VI is the computation of the stress distribution at the temperature distribution assumed to be present shortly after the wheel has stopped turning. The essential parts of the calculation are shown in table VI. Because no flow was found in example V, the $[P'_n] + [Q'_n]$ term will be the same in this example as it was in example V. Plastic flow occurs at station b. The resulting stresses are plotted in figure 13, together with the elastic stresses computed without consideration of previous plastic flow and creep.

Example VII. - Example VII is the computation of the stress distribution in the disk after the temperature has become uniform at the ambient temperature (assumed to be 70° F) throughout the disk. These stresses are therefore the residual stresses in the disk resulting from the flow occurring during the complete operating cycle. The abridged calculations given in table VII indicate that plastic flow occurs at station b and the residual stresses are plotted in figure 14.

Discussion of numerical examples. - The foregoing cycle of stress calculations is indicative of the means of obtaining a complete analysis of the stress behavior of a turbine disk. Although the results plotted in the various figures and summarized in figure 15 do not represent the exact behavior of any particular turbine disk because of the lack of data on the material properties and temperature gradients, they do give a qualitative picture of the behavior of a turbine disk with welded blades. The high residual tensile stress at the rim of the wheel provides a plausible explanation of the rim cracking that has occurred in such wheels. The compressive flow at the rim during starting and the tensile flow on stopping result in cyclic flow of the rim material with each start and stop and possibly induce cracks. When accurate data are available on creep, stress-strain curves, the effect of strain-hardening, and temperature distribution, quantitative analyses of disk behavior will be available as a guide in future turbine design.

CONCLUSIONS

A method for studying the operating stresses in gas-turbine disks has been presented that includes consideration of the effect of plastic flow and creep on the stress distribution. Results of calculations indicate that rim cracking in turbine wheels with

welded blade attachments may be caused by alternate compressive and tensile plastic flow as the wheel is alternately heated and cooled. From the results of the numerical examples presented, it may be qualitatively concluded that plastic flow alters the elastic-stress distribution markedly and that, if the amount of creep is small, the effect on the stress distribution is also small.

Flight Propulsion Research Laboratory,
National Advisory Committee for Aeronautics,
Cleveland, Ohio, March 5, 1948.

APPENDIX - STRESS CALCULATION FOR DISK
WITH CENTRAL HOLE

The calculations given in the section of the report entitled "NUMERICAL EXAMPLES" dealt with a disk that was solid at the center and had temperature gradients such that the plastic flow was confined to the region of the rim. Disks of other types spun under different conditions may be subject to plastic flow in other regions.

One example of such a disk is a parallel-sided disk with a central hole spun at a uniform temperature. In this disk plastic flow first occurs in the region of the central hole. Such a disk spun at a speed great enough to cause some flow near the hole is calculated here.

The essential columns of the elastic calculation are given in table VIII(a). Flow is indicated at stations a, 2, 3, and 4. However, as flow occurs the stresses farther out in the disk may be increased. The quantities depending on disk dimensions, together with the first approximation, shown in table VIII(b), are found in the manner given in the text. However, when the values of $B_{r,n}$ and $B_{t,n}$ (columns 57 and 58) are found for the stations at which flow occurs, new values of $B_{r,n}$ and $B_{t,n}$ must be computed for all other point stations also before a new value of $\sigma_{t,a}$ (column 59) can be found. These computations are also shown in table VIII(b) for the first approximation. Additional approximations must be made in the same manner until the correct flow increments are found. The stresses so calculated are plotted in figure 16.

Where large numbers of computations involving plastic flow at the center of the disk are to be made, it may be desirable to change the finite-difference approach to the problem in such a manner that the calculations are made from the outside of the disk toward the center instead of from the center towards the rim. This procedure has certain disadvantages as a general approach to the problem of stresses in disks, particularly in that it requires a greater number of significant figures to obtain the same accuracy. However, for special applications it may present advantages that outweigh the disadvantages in more general problems.

REFERENCES

1. Manson, S. S.: The Determination of Elastic Stresses in Gas-Turbine Disks. NACA TN No. 1279, 1947.
2. Thompson, A. Stanley: Stresses in Rotating Disks at High Temperatures. Jour. Appl. Mech., vol. 13, no. 1, March 1946, pp. A45-A52.
3. Nadai, A.: Plasticity. McGraw-Hill Book Co., Inc. (New York), 1931, pp. 72-74.
4. Soderberg, C. Richard.: The Interpretation of Creep Tests for Machine Design. A.S.M.E. Trans., vol. 58, no. 8, Nov. 1936, pp. 733-743.
5. Taylor, G. I., and Quinney, H.: The Plastic Distortion of Metals. Phil. Trans. Roy. Soc. London, Ser. A., vol. 230, Feb. 1932, p. 323.
6. Fleischmann, Martin: 16-25-6 Alloy for Gas Turbines. Iron Age, vol. 157, no. 3, Jan. 17, 1946, pp. 44-53.
7. Fleischmann, Martin: 16-25-6 Alloy for Gas Turbines. Iron Age, vol. 157, no. 4, Jan. 24, 1946, pp. 50-60.

TABLE I. - CALCULATION OF STRESS DISTRIBUTION FOR EXAMPLE I

(a) Elastic-stress calculation

n	1	2	3	4	5	6	7	8	9	10	11	12	13	14
	r_n	h_n	P_{n1}^2	u_n	E_n	a_n	ΔT_n	C_n		D_n	Q_n			H_n
								(1)x(2)	(1)-(1) _{n-1}	(2)x(9)	(2) _{n-1} x(9)	(3)x(8) x(1)	(12)+ (12) _{n-1}	(9)x(13)
									2					
a	0.5000	4.3750			30.400×10^6	8.8970×10^{-6}	0	2.1875				584.88		
2	.8250	4.3750			30.400	8.8970	0	2.7344	0.06850	0.27344	0.27344	913.85	1,488.7	95.672
3	.7500	4.3750			30.400	8.8970	0	3.2812	.06250	.27344	.27344	1,315.9	2,229.8	139.36
4	1.0000	4.3750			30.400	8.8970	0	4.3750	.12500	.54688	.54688	2,339.4	3,855.3	456.92
5	1.2500	4.3750			30.400	8.8970	0	5.4688	.12500	.54688	.54688	3,655.4	5,994.8	749.37
6	1.5000	4.3750			30.400	8.8970	0	6.5625	.12500	.54688	.54688	5,285.8	8,919.2	1,114.9
7	2.0000	4.3750			30.400	8.8970	0	8.7500	.25000	1.0938	1.0938	9,357.8	14,628	3,655.4
8	3.0000	3.8400			30.400	8.8970	0	11.820	.50000	1.9800	8.1875	18,480	27,838	13,919
9	4.0000	3.2750			30.400	8.8970	0	13.100	.80000	1.6375	1.9200	28,080	46,500	23,250
10	5.0000	2.5900			30.300	8.3020	3.00	13.400	.80000	1.3400	1.6375	36,887	63,847	31,923
11	5.5000	2.3700			30.300	8.3080	7.00	13.045	.25000	.59300	.87000	38,368	74,195	18,548
12	6.0000	2.8100			30.200	8.3840	17.00	13.860	.25000	.59300	.89300	42,543	80,911	20,228
13	6.5000	2.1600			30.100	8.5680	38.00	14.040	.25000	.54000	.56860	48,799	91,348	22,836
14	7.0000	2.1580			30.000	8.4240	79.00	15.085	.25000	.53875	.54000	58,467	105,870	26,317
15	7.5000	2.7000			29.600	8.5500	158.00	20.850	.25000	.67500	.53875	81,212	137,680	34,480
16	8.0000	2.7000			28.900	8.7810	308.00	21.500	.25000	.67500	.87500	98,401	173,580	45,404
17	8.2500	2.5500			28.400	8.9550	410.00	21.038	.12500	.51875	.53750	92,806	185,210	25,151
18	8.5000	2.3800			27.600	9.1840	565.00	20.230	.12500	.29750	.51875	91,953	184,760	23,095
19	8.7500	2.1450			26.000	9.4820	739.00	18.769	.12500	.28613	.29750	87,819	179,770	22,471
b	9.0000	1.9100			22.100	9.8690	980.00	17.190	.12500	.23875	.26612	82,788	170,560	21,319

n	15	16	17	18	19	20	21	22	23	24
	$1/(5)$	(4)x(15)	$[1+(4)]x(15)$ (1)	(17)x(9)	(17) _{n-1} x(9)	(16)+(18)	(15)+(18)	(16) _{n-1} -(19)	(15) _{n-1} -(19)	(6)x(7)
a	0.032895×10^{-8}	0.011513×10^{-6}	0.089816×10^{-8}							
2	.032895	.011513	.071053	0.0044410×10^{-8}	0.0055810×10^{-8}	0.015854×10^{-8}	0.037336×10^{-8}	0.0059820×10^{-8}	0.087344×10^{-6}	0
3	.032895	.011513	.059811	.0037010	.0044410	.015814	.036598	.0070720	.028454	0
4	.032895	.011513	.044408	.0065510	.0074010	.017064	.036446	.0041120	.025494	0
5	.032895	.011513	.035526	.0044410	.0055310	.018954	.037336	.0059820	.027344	0
6	.032895	.011513	.029805	.0037010	.0044410	.015814	.036598	.0070720	.028454	0
7	.032895	.011513	.022804	.0055510	.0074010	.017064	.036446	.0041120	.025494	0
8	.032895	.011513	.014803	.0074010	.011108	.018914	.040298	.00041100	.021793	0
9	.032895	.011513	.011102	.0055510	.0074010	.017064	.036446	.0041120	.025494	0
10	.033003	.011551	.0089109	.0044550	.0055510	.016006	.037458	.0059820	.027344	24.806
11	.033003	.011551	.0081007	.0080250	.0022280	.013578	.035028	.0093230	.030775	58.156
12	.033112	.011589	.0074502	.0018530	.0080250	.013458	.034975	.0093230	.030978	141.508
13	.033222	.011628	.0069000	.0017850	.0018830	.013353	.034947	.0097250	.031249	317.604
14	.033333	.011667	.0064296	.0016070	.0017850	.013274	.034840	.0099030	.031497	565.496
15	.033784	.011824	.0050811	.0015800	.0016070	.013344	.035304	.010060	.031726	1350.90
16	.034808	.012111	.0058391	.0014800	.0015200	.013571	.036062	.010304	.032264	2551.86
17	.035211	.012324	.0057618	.0007200	.00073000	.013044	.035931	.011381	.035872	3671.55
18	.038384	.012787	.0057754	.00072200	.00072000	.013449	.037086	.011804	.034491	5078.75
19	.038452	.013462	.0059342	.00074200	.00072200	.014204	.039204	.012005	.035842	7007.20
b	.045249	.015837	.0067873	.00084800	.00074200	.016685	.046097	.012720	.037720	8571.68

TABLE I. - CALCULATION OF STRESS DISTRIBUTION FOR EXAMPLE I - Continued

(a) Elastic-stress calculation - Concluded

	25	25a	25b	26	27	28	29	30	31
	$H'_{n'}$	$[P'_{n'} + (Q'_{n'})]$	$H'_{n'} - [P'_{n'}] - (Q'_{n'})$	$(20) \times (10)$	$[(22) \times (10) - (8)_{n-1} \times (21)] + (26)$	$[(23) \times (10) + (11) \times (21)] + (26)$	$[(8) \times (22) - (80) \times (8)_{n-1}] + (26)$	$[(80) \times (11) + (8) \times (23)] + (26)$	$[(85b) \times (10) + (14) \times (21)] + (26)$
a	0	Constant at 0	0	$-0.0977289 \times 10^{-6}$	0.81908	0.18097	0.119089	0.80971	-35.786
2	0		0	-1.1592	.84857	.15344	.15870	.84130	-45.996
3	0		0	-1.15867	.77988	.22010	.23919	.76080	-110.57
4	0		0	-1.19546	.81901	.18097	.19029	.80970	-143.14
5	0		0	-2.3184	.84857	.15344	.15870	.84131	-176.99
6	0		0	-3.1774	.77990	.22011	.23920	.78080	-442.30
7	0		0	-4.8790	.82816	.30379	.37570	.68343	-1,310.8
8	0		0	-4.7870	.91689	.24283	.30000	.77094	-1,879.1
9	0		0	-4.8049	1.0046	.20391	.27018	.81712	-8,568.1
10	84.906		84.906	-4.4898	1.0333	.092930	.13430	.91461	-1,491.2
11	33.250		33.250	-4.4634	.98834	.062955	.10777	.91762	-1,651.8
12	83.352		83.352	-4.4835	.94768	.074844	.083789	.92277	-1,847.4
13	176.10		176.10	-4.4992	.93328	.068927	.071127	.92764	-2,129.1
14	347.89		347.89	-7.0590	.74482	.027982	-.0034293	.92030	-2,376.8
15	685.40		685.40	-7.6978	.93982	.059913	.067872	.91723	-3,174.8
16	1501.0		1301.0	-7.75176	1.0876	.030425	.064890	.98376	-1,638.9
17	1019.7		1019.7	-7.4625	1.0409	.029581	.064578	.94078	-1,708.7
18	1407.2		1407.2	-7.73201	1.0791	.038988	.064733	.91985	-1,909.8
19	1928.4		1928.4	-7.8842	1.0935	.027099	.11996	.82809	-2,053.3
b	2664.4		2664.4						

	32	33	34	35	36	37	38	39	40	41
n	$M'_{n'}$	$A'_{r,n'}$	$A'_{t,n'}$	$B'_{r,n'}$	$B'_{t,n'}$	$\sigma'_{t,n'}$	$\sigma'_{r,n'}$	$\sigma'_{t,n'}$	$\sigma'_{y,n'}$	$\sigma'_{e,n'}$
	$[(80) \times (14) + (8) \times (25b)] + (26)$	$(27) \times (23)_{n-1} + (28) \times (24)_{n-1}$	$(29) \times (33)_{n-1} + (30) \times (34)_{n-1}$	$(27) \times (35)_{n-1} + (28) \times (36)_{n-1} + (31)$	$(29) \times (35)_{n-1} + (30) \times (36)_{n-1} + (32)$	$[\sigma'_{t,b} - (35)_b] + (33)_b$	$(33) \times (37) + (35)$	$(34) \times (37) + (38)$		$\sqrt{(38)^2 + (39)^2} - (38) \times (39)$
a		1.0000	1.0000	0	0	Constant at 27,755 for $\sigma'_{t,b}$ of 4595 lb/sq in. (fig. 6)	27,755	27,755	73,500	27,755
2	-15.292	.99999	1.0000	-35.786	-15.292		27,719	27,740	73,500	27,750
3	-18.290	1.0000	1.0000	-78.638	-36.834		27,678	27,718	73,500	27,698
4	-49.077	.99998	.99999	-178.45	-95.431		27,576	27,659	73,500	27,618
5	-81.186	.99998	.99998	-305.55	-172.39		27,447	27,588	73,500	27,615
6	-73.163	.99997	.99999	-451.97	-266.83		27,282	27,488	73,500	27,391
7	-196.31	.99998	.99999	-861.33	-509.83		26,893	27,245	73,500	27,071
8	-615.25	1.1259	1.0591	-8,173.8	-1,287.3		29,078	28,108	73,500	28,604
9	-834.01	1.2898	1.1843	-4,185.0	-2,478.6		31,608	29,689	73,500	30,638
10	-1,788.0	1.6309	1.8916	-7,887.8	-4,813.8		35,223	30,932	73,500	33,285
11	-1,637.2	1.7019	1.3868	-9,457.7	-6,997.5	Constant at 27,755 for $\sigma'_{t,b}$ of 4595 lb/sq in. (fig. 6)	37,779	31,493	73,500	36,051
12	-3,018.3	1.7971	1,4560	-11,579	-10,459		38,300	29,988	73,500	34,883
13	-5,744.9	1.8120	1,4941	-13,603	-16,366		38,889	25,103	73,500	32,488
14	-10,786	1.7941	1,5149	-15,958	-26,915		33,843	15,131	73,500	29,264
15	-20,313	1.4231	1,3880	-15,800	-45,028		23,898	-6,504	73,500	27,532
16	-37,871	1.4803	1,3697	-20,718	-79,644		18,702	-41,628	73,500	53,490
17	-28,939	1.5013	1,3853	-25,267	-108,070		16,412	-87,592	72,000	77,120
18	-38,664	1.6037	1,4011	-31,137	-139,980		13,374	-101,090	70,500	106,800
19	-48,891	1.7712	1,4244	-39,287	-161,250		9,593	-141,720	67,000	148,750
b	-58,843	1.9754	1,3918	-50,232	-213,380		4,595	-174,750	54,000	177,020



TABLE I. - CALCULATION OF STRESS DISTRIBUTION FOR EXAMPLE I - Continued

(b) Constants determined by disk geometry to be used in all plastic calculations

	42	43	44	45
n	(9)/(1)	(9)/(1) _{n-1}	1 + (42)	1 - (43)
17	0.015152	0.015525	1.0152	0.98438
18	.014705	.015152	1.0147	.98485
19	.014288	.014705	1.0143	.98529
b	.013889	.014288	1.0139	.98571

(c) Plastic-stress calculation

Approximation	n	46 e _{p,n} (graph reading, fig. 7)	46a e _{p,n} (estimate)	47 Δ _{r,n} (46a) (82)x2 x [2(50)-(51)]	48 Δ _{t,n} (46a) (68)x2 x [2(51)-(50)]	49 (47)x(42)	50 (47) _{n-1} x(43)	51 (48)x(44)	52 (48) _{n-1} x(45)	53 P' _n (49)+(50) -(51)+(52)
1	17	20x10 ⁻⁵	20x10 ⁻⁵	13.021x10 ⁻⁵	-19.857x10 ⁻⁵	0.19729x10 ⁻⁵	0.00000x10 ⁻⁵	-19.856x10 ⁻⁵	0.000x10 ⁻⁵	20.153x10 ⁻⁵
	18	670	670	395.07	-682.15	5.8099	0.19789	-675.94	-19.389	662.59
	19	1850	1850	1014.2	-1847.1	14.489	5.8099	-1875.5	-666.35	1237.4
	b	3960	3960	2056.6	-3989.1	28.564	14.489	-4014.1	-1620.7	2235.5
2	17	20	20	12.562	-19.759	0.19034	0	-20.059	0	20.249
	18	690	685	402.14	-681.31	5.9139	.19034	-681.33	-19.460	677.97
	19	1890	1865	1040.3	-1860.7	14.668	5.9139	-1887.3	-671.29	1236.8
	b	4650	4300	2312.1	-4298.8	32.113	14.668	-4355.5	-1634.1	2568.4
3	17	20	20	12.544	-19.788	0.19007	0	-20.062	0	20.258
	18	670	670	393.05	-686.43	5.7802	.19007	-676.23	-19.463	662.74
	19	1850	1860	1035.5	-1855.8	14.807	5.7802	-1882.3	-666.63	1246.3
	b	1900	4100	2218.5	-4095.2	30.810	14.807	-4182.1	-1889.3	2368.4
4	17	20	20	12.555	-19.760	0.19023	0	-20.060	0	20.250
	18	690	680	398.99	-676.38	5.8675	.19023	-686.30	-19.461	672.90
	19	1860	1860	1037.2	-1855.7	14.817	5.8675	-1882.2	-666.42	1236.5
	b	2900	4000	2156.0	-3995.8	29.945	14.817	-4051.5	-1829.2	2255.9
5	17	20	20	12.558	-19.759	0.19028	0	-20.059	0	20.249
	18	680	680	399.27	-676.33	5.8717	.19028	-686.27	-19.460	672.87
	19	1880	1880	1037.5	-1855.7	14.822	5.8717	-1882.2	-666.36	1236.5
	b	4200	4015	2160.3	-4011.0	30.004	14.822	-4065.8	-1829.2	2282.4
6	17	20	20	12.557	-19.780	0.19026	0	-20.060	0	20.250
	18	680	680	399.25	-677.14	5.8714	.19026	-686.27	-19.461	672.87
	19	1860	1860	1037.5	-1855.7	14.822	5.8714	-1882.2	-666.36	1236.5
	b	4015	4015	2160.3	-4011.0	30.011	14.822	-4066.8	-1829.2	2282.4



TABLE I. - CALCULATION OF STRESS DISTRIBUTION FOR EXAMPLE I - Concluded

(a) Plastic stress calculation - Concluded

Approx- imation	n	54	55	56	57	58	59	60	61	62
		$H'n - [P'n] - [Q'h]$ $-P'n$ $(25b) - (55)$	M_n $(54) \times (10)$ $+ (14) \times (21)$ $+ (28)$	$M'n$ $(54) \times (8)$ $+ (14) \times (20)$ $+ (28)$	$B_{r,n}$ $(27) \times (57)_{n-1}$ $+ (28) \times (58)_{n-1}$ $+ (55)$	$B_{t,n}$ $(29) \times (57)_{n-1}$ $+ (30) \times (58)_{n-1}$ $+ (55)$	$\sigma_{t,a}$ $(\sigma_{r,b} - (57)_b)$ $+ (33)_b$	$\sigma_{r,n}$ $(53) \times (59)$ $+ (57)$	$\sigma_{t,n}$ $(54) \times (59)$ $+ (58)$	$\sigma_{e,n}$ $\sqrt{(60)^2 + (61)^2}$ $- (60) \times (61)$
Values from elastic-stress calculation, table I(a)	16	1301.0×10^{-6}	-5174.2	-37,271	-20,718	-79,644	27,755	18,702	-41,628	53,490
	17	1019.7	-1538.9	-28,938	-25,257	-106,070		18,412	-67,593	77,120
	18	1407.2	-1708.7	-38,564	-31,137	-139,990		13,374	-101,090	108,400
	19	1928.4	-1909.8	-49,681	-39,667	-181,250		9,592.7	-141,720	145,750
	b	2864.4	-2053.3	-58,543	-50,232	-213,360		4,595.2	-174,750	177,090
1	17	999.55	-1530.3	-28,374	-25,249	-105,500	26,023	13,819	-69,424	77,266
	18	744.61	-1444.6	-20,602	-30,848	-121,480		10,885	-85,019	90,952
	19	691.00	-1456.8	-18,154	-38,286	-132,480		7,825.9	-95,423	99,567
	b	427.90	-1378.0	-9,780.7	-46,810	-124,080		4,595.8	-87,861	90,847
2	17	999.45	-1530.3	-28,371	-25,249	-105,500	25,957	13,720	-69,816	77,295
	18	729.23	-1439.5	-20,185	-30,842	-121,070		10,785	-84,702	90,577
	19	691.60	-1456.8	-18,169	-38,248	-132,120		7,727.0	-95,147	99,237
	b	66.000	-1275.5	-2,544.3	-46,680	-116,540		4,595.5	-80,413	82,807
3	17	999.45	-1530.3	-28,371	-25,249	-105,500	25,998	13,782	-69,459	77,277
	18	744.46	-1444.5	-20,598	-30,848	-121,480		10,845	-85,054	90,963
	19	682.10	-1455.3	-17,925	-38,263	-132,290		7,784.7	-95,228	99,349
	b	298.00	-1338.1	-5,904.9	-46,761	-121,010		4,595.4	-84,828	87,316
4	17	999.45	-1530.3	-28,371	-25,249	-105,500	26,008	13,797	-69,445	77,273
	18	734.30	-1440.5	-20,322	-30,844	-121,200		10,855	-84,760	90,682
	19	691.90	-1456.9	-18,177	-38,254	-132,250		7,811.4	-95,204	99,340
	b	397.50	-1366.8	-9,117.9	-46,781	-123,220		4,895.2	-87,028	89,408
5	17	999.45	-1530.3	-28,371	-25,249	-105,500	^a 26,006	13,794	-69,448	77,274
	18	734.33	-1440.5	-20,323	-30,844	-121,200		10,862	-84,763	90,683
	19	691.90	-1456.9	-18,177	-38,254	-132,250		7,807.8	-95,207	99,341
	b	382.00	-1362.1	-9,772.9	-46,777	-122,890		4,595.3	-86,686	89,072

^a This value of $\sigma_{t,a}$ is also substituted for the original value of $\sigma_{t,a}$ used in table I(a) to compute plastic stress for stations a to 16.

TABLE II. - AERIDGED VALUES FROM CALCULATION OF STRESS DISTRIBUTION FOR EXAMPLE II

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21
n	r_n	h_n	E_n	a_n	ΔT_n	H'_n	$[P'_n] + [Q'_n]$	$H'_n - [P'_n] - [Q'_n]$	$\sigma_{r,n}$	$\sigma_{t,n}$	$H'_n - [P'_n] - [Q'_n]$	$\sigma_{r,n}$	$\sigma_{t,n}$								
1	0.5000	4.3750	29.700x10 ⁸	8.5060x10 ⁻⁶	130				36,093	36,093		36,093	36,093								
2	.6250	4.3750	29.700	8.5060	130	0	0	0	36,037	36,069	0	36,037	36,069								
3	.7500	4.3750	29.700	8.5060	130	0	0	0	35,973	36,035	0	35,973	36,035								
4	1.0000	4.3750	29.700	8.5080	130	0	0	0	35,814	36,044	0	35,814	36,044								
5	1.2500	4.3750	29.700	8.5080	130	0	0	0	35,813	36,891	0	35,813	36,891								
6	1.5000	4.3750	29.700	8.5080	130	0	0	0	35,370	36,875	0	35,370	36,875								
7	2.0000	4.3750	29.700	8.5080	130	0	0	0	34,746	36,295	0	34,746	36,295								
8	3.0000	5.8400	29.700	8.5080	130	0	0	0	37,240	36,815	0	37,240	36,815								
9	4.0000	5.2750	29.700	8.5070	131	8.6400	0	8.6400	39,977	37,557	8.6400	39,977	37,557								
10	5.0000	2.6000	29.700	8.5180	138	61.060	0	61.060	43,774	38,228	61.060	43,774	38,228								
11	6.0000	2.3780	29.600	8.5330	147	78.870	0	78.870	46,415	37,649	78.870	46,415	37,649								
12	6.0000	2.2100	29.600	8.5620	165	156.38	0	156.38	46,390	34,176	156.38	46,390	34,176								
13	8.5000	2.1600	29.400	8.6130	197	284.03	0	284.03	43,827	28,320	284.03	43,827	28,320								
14	7.0000	2.1550	29.800	8.7000	251	486.94	0	486.94	39,275	18,677	486.94	39,275	18,677								
15	7.5000	2.7000	28.700	8.8410	339	813.40	0	813.40	26,536	-12,108	813.40	26,536	-12,108								
16	8.0000	2.7000	27.900	9.0680	481	1364.6	0	1364.6	19,878	-47,387	1364.6	19,878	-47,387								
17	8.2500	2.5500	27.500	9.2860	579	980.14	20,250	959.89	16,963	-70,310	959.89	16,963	-70,310								
18	8.5000	2.3800	28.400	9.4200	700	1252.8	678.87	573.93	13,459	-80,667	573.93	13,459	-80,667								
19	8.7500	2.1450	24.700	9.5870	848	1595.1	1234.5	360.60	10,182	-81,665	360.60	10,182	-81,665								
20	9.0000	1.9100	20.700	9.9490	1030	2058.3	2228.4	-164.10	7,062	-61,849	-105.13	7,062	-61,849								

TABLE III. - AERIDGED VALUES FROM CALCULATION OF STRESS DISTRIBUTION FOR EXAMPLE III

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21
	r_n	h_n	E_n	a_n	ΔT_n	H'_n	$[P'_n] + [Q'_n]$	$H'_n - [P'_n] - [Q'_n]$	$\sigma_{r,n}$	$\sigma_{t,n}$	$H'_n - [P'_n] - [Q'_n]$	$\sigma_{r,n}$	$\sigma_{t,n}$								
1	0.5000	4.3750	28.800x10 ⁸	8.8280x10 ⁻⁶	330				44,435	44,435		44,435	44,435								
2	.6250	4.3750	28.800	8.8280	330	0	0	0	44,381	44,403	0	44,381	44,403								
3	.7500	4.3750	28.800	8.8260	330	0	0	0	44,277	44,359	0	44,277	44,359								
4	1.0000	4.3750	28.800	8.8260	330	0	0	0	44,068	44,238	0	44,068	44,238								
5	1.2500	4.3750	28.800	8.8260	330	0	0	0	43,802	44,079	0	43,802	44,079								
6	1.5000	4.3750	28.800	8.8260	330	0	0	0	43,480	43,884	0	43,480	43,884								
7	2.0000	4.3750	28.800	8.8260	330	0	0	0	42,655	43,391	0	42,655	43,391								
8	3.0000	5.8400	28.800	8.8260	351	9.5000	0	9.5000	46,497	44,159	9.5000	46,497	44,159								
9	4.0000	5.2750	28.700	8.8360	358	48.800	0	48.800	46,399	44,631	48.800	46,399	44,631								
10	5.0000	2.6000	28.700	8.8620	358	180.80	0	180.80	43,198	43,481	180.80	43,198	43,481								
11	5.5000	2.3780	28.600	8.8890	369	160.60	0	160.60	54,778	41,185	160.60	54,778	41,185								
12	6.0000	2.2100	28.400	8.9310	395	247.70	0	247.70	54,068	35,858	247.70	54,068	35,858								
13	6.5000	2.1600	28.200	8.9980	436	394.60	0	394.60	50,088	25,238	394.60	50,088	25,238								
14	7.0000	2.1550	27.900	9.0950	496	587.60	0	587.60	44,943	9,680	587.60	44,943	9,680								
15	7.5000	2.7000	27.300	9.2290	581	851.90	0	851.90	39,200	-15,112	851.90	39,200	-15,112								
16	8.0000	2.7000	26.400	9.4200	700	1232.0	0	1232.0	21,358	-44,828	1232.0	21,358	-44,828								
17	8.2500	2.5500	25.700	9.5400	775	799.50	141.19	658.31	18,041	-58,588	658.31	18,041	-58,588								
18	8.5000	2.3800	24.600	9.6780	868	949.80	878.12	77.68	14,659	-58,758	91.355	14,659	-58,758								
19	8.7500	2.1450	22.400	9.8410	953	1133.6	1343.5	-209.90	11,807	-44,485	200.34	11,807	-44,485								
20	9.0000	1.9100	19.300	10.039	1080	1364.1	2183.4	-809.30	9,339	-21,474	-609.30	9,339	-21,474								



TABLE IV. - CALCULATION OF STRESS DISTRIBUTION FOR EXAMPLE IV

(a) Abridged values

	1	2	3	4	5	6	7	25	25a	25b	38	39	72	73	79	
n	r_n	h_n	E_n	a_n	ΔT_n	H'_n	$[P'_n + Q'_n]$	$H'_n - [P'_n] - [Q'_n]$	$\sigma_{r,n}$	$\sigma_{t,n}$	$H'_n - [P'_n] - [Q'_n]$	$\sigma_{r,n}$	$\sigma_{t,n}$	$H'_n - [P'_n] - [Q'_n]$	$\sigma_{r,n}$	$\sigma_{t,n}$
a	0.5000	4.3750	27.600x10 ⁶	9.1470x10 ⁻⁶	530	0	0	0	0	0	46,006	46,006	0	46,006	46,006	
2	.6850	4.3750	27,600	9.1470	530	0	0	0	0	0	46,932	46,974	0	46,931	46,973	
3	.7500	4.3750	27,600	9.1470	530	0	0	0	0	0	45,848	45,930	0	45,847	45,929	
4	1.0000	4.3780	27,600	9.1470	530	0	0	0	0	0	45,837	45,809	0	45,836	45,808	
5	1.8500	4.3780	27,600	9.1470	530	0	0	0	0	0	45,373	45,660	0	45,372	45,649	
6	1.5000	4.3750	27,600	9.1470	530	0	0	0	0	0	45,051	45,455	0	45,050	45,454	
7	2.0000	4.3750	27,600	9.1490	531	10,200	0	10,200	0	10,200	44,194	44,898	10,200	44,193	44,697	
8	3.0000	3.8400	27,600	9.1580	537	59,700	0	59,700	0	59,700	44,419	44,419	59,700	44,418	44,418	
9	4.0000	3.2780	27,600	9.1840	553	161,00	0	161,00	0	161,00	49,449	48,507	161,00	49,448	48,506	
10	5.0000	2.6800	27,300	9.2380	587	343,90	0	343,90	0	343,90	52,329	37,155	343,90	52,328	37,154	
11	5.5000	2.3720	27,100	9.2820	614	276,40	0	276,40	0	276,40	54,197	32,527	276,40	54,195	32,526	
12	6.0000	2.2100	26,800	9.3380	649	361,30	0	361,30	0	361,30	52,868	25,030	361,30	52,866	25,028	
13	6.5000	2.1600	26,800	9.4080	693	459,30	0	459,30	0	459,30	47,920	14,400	459,30	47,918	14,399	
14	7.0000	2.1550	25,900	9.5000	730	605,30	0	605,30	0	605,30	41,517	827	605,30	41,515	827	
15	7.5000	2.7000	25,100	9.6100	819	745,80	0	745,80	0	745,80	26,780	-19,803	745,80	26,778	-19,804	
16	8.0000	2.7000	23,800	9.7480	906	951,30	0	951,30	0	951,30	19,148	-36,527	951,30	19,145	-36,528	
17	8.2500	2.5500	22,700	9.9870	954	705,70	166.17	539.83	0	539.83	16,107	-45,488	539.84	16,105	-45,443	
18	8.5000	2.3800	21,200	9.9120	1007	455,80	858.44	-404.84	0	-404.84	13,200	-32,446	-405.17	13,199	-32,418	
19	8.7500	2.1450	19,800	10.007	1086	685,80	1334.0	-648.40	0	-648.40	11,008	-16,554	-647.94	11,003	-16,536	
b	9.0000	1.9100	17,900	10.109	1130	756,00	8163.4	-1407.4	0	-1407.4	9,340	10,470	-1408.5	9,334	10,470	

(b) Calculation of effect of creep on final stresses

n	63	64	65	66	67	68	69	70	71
	c_n	Γ_{n1}	$\delta_{r,n}$	$\delta_{t,n}$	$(65) \times (42)$	$(65)_{n-1} \times (43)$	$(66) \times (44)$	$(66)_{n-1} \times (45)$	Q'_n
		(63) x 5	(64) x 2 x [2(36) - (39)]	(64) x 2 x [2(39) - (38)]					(67) + (68) - (69) + (70)
17	0.2×10^{-6}	1.0×10^{-6}	0.70226×10^{-6}	-0.96766×10^{-6}	0.010641×10^{-6}	0.00000×10^{-6}	-0.98237×10^{-6}	-0.00000×10^{-6}	0.99301×10^{-6}
18	.3	1.5	1.0848	-1.4596	.015953	.010641	-1.4808	-.98300	.53439
19	.2	1.0	.80246	-.91800	.011464	.015953	-.93113	-1.4184	-.45985
b	0	0	0	0	0	.011464	0	-.90468	-.89342

n	72	73	74	75	76	77	78	79
	$H'_n - [P'_n] - [Q'_n]$	M_n	H'_n	$\sigma_{r,n}$	$\sigma_{t,n}$	$\sigma_{t,a}$	$\sigma_{r,n}$	$\sigma_{t,n}$
	(25b) - (71)	[(72) x (10) + (14) x (21)] + (86)	[(72) x (8) + (14) x (20)] + (26)	(27) x (75)_{n-1} + (28) x (76)_{n-1} + (73)	(29) x (78)_{n-1} + (30) x (79)_{n-1} + (74)	[(27) x (75)_{n-1} + (28) x (76)_{n-1}] + (33)_{n-1}	(33) x (77) + (75)	(34) x (77) + (76)
17	538.54×10^{-6}	-2469.1	-12,876	-52,373	-105,190	46,005	16,105	-45,443
18	-405.17	-2247.2	7,607.5	-59,854	-91,628		13,199	-32,418
19	-647.94	-2306.2	11,751	-69,580	-78,973		11,003	-18,536
b	-1408.5	-2230.7	23,905	-80,379	-60,665		9,334	10,470



TABLE V. - ABRIDGED VALUES FROM CALCULATION OF STRESS DISTRIBUTION FOR EXAMPLE V

	1	2	3	4	5	6	7	25	25a	25b	38	39	54	60	61
n	r_n	h_n	E_n	a_n	ΔT_n	H'_n	$[P'_n] + [Q'_n]$	$H'_n - [P'_n] - [Q'_n]$	$\sigma_{r,n}$	$\sigma_{t,n}$	$H'_n - [P'_n] - [Q'_n]$ - P'_n	$\sigma_{r,n}$	$\sigma_{t,n}$	$\sigma_{r,n}$	$\sigma_{t,n}$
a	0.5000	4.3750	28.800×10^8	8.8280×10^{-6}	331										
2	.6250	4.3750	28.800	8.8300	332	9.49×10^{-6}	0×10^{-6}	9.49×10^{-6}	22,285	22,285				22,285	22,285
3	.7500	4.3750	28.800	8.8310	333	9.15	0	9.15	22,253	22,023	9.49×10^{-6}			22,253	22,023
4	1.0000	4.3750	28.800	8.8330	334	9.50	0	9.50	22,181	21,811	9.15			22,181	21,811
5	1.8500	4.3750	28.700	8.8390	338	37.38	0	37.38	22,027	21,645	9.80			22,027	21,645
6	1.5000	4.3750	28.700	8.8440	341	28.22	0	28.22	21,801	20,687	37.38			21,801	20,687
7	2.0000	4.3750	28.700	8.8580	350	84.50	0	84.50	21,501	20,085	28.22			21,501	20,085
8	3.0000	3.8400	28.800	8.8970	374	228.70	0	228.70	20,744	18,160	84.50			20,744	18,160
9	4.0000	3.2750	28.500	8.9530	409	334.78	0	334.78	21,090	14,149	228.70			21,090	14,149
10	5.0000	2.6800	28.100	9.0240	453	428.09	0	428.09	8,300	334.78				20,964	8,300
11	5.5000	2.3720	28.000	9.0650	479	254.27	0	254.27	20,580	1,010	428.09			20,580	1,010
12	6.0000	2.1000	27.800	9.1120	508	287.76	0	287.76	20,585	-3,342	254.27			20,585	-3,342
13	6.5000	2.1600	27.600	9.1620	539	309.42	0	309.42	19,144	-8,724	287.76			19,144	-8,724
14	7.0000	2.1530	27.400	9.2140	572	332.09	0	332.09	18,529	-14,887	309.42			18,529	-14,887
15	7.5000	2.7000	27.100	9.2780	608	366.97	0	366.97	15,400	-21,552	332.09			15,400	-21,552
16	8.0000	2.7000	26.800	9.3350	645	391.74	0	391.74	7,748	-29,887	366.97			7,748	-29,887
17	8.2500	2.5500	26.700	9.3650	668	207.97	167.16	40.840	4,385	-37,781	391.74			4,385	-37,781
18	8.5000	2.3800	26.500	9.3990	687	220.02	858.97	-638.97	2,879	-37,429	40.840			2,879	-37,429
19	8.7500	2.1450	26.500	9.4490	708	232.78	1333.5	-1100.5	1,675	-19,393	-638.97			1,675	-19,393
20	9.0000	1.9100	26.100	9.4990	730	244.38	2182.5	-1918.5	1,171	9,833	-1100.5			1,171	9,833
									1,764	58,858	-1918.5			1,764	58,858

TABLE VI. - ABRIDGED VALUES FROM CALCULATION OF STRESS DISTRIBUTION FOR EXAMPLE VI

	1	2	3	4	5	6	7	25	25a	25b	38	39	54	60	61
n	r_n	h_n	E_n	a_n	ΔT_n	H'_n	$[P'_n] + [Q'_n]$	$H'_n - [P'_n] - [Q'_n]$	$\sigma_{r,n}$	$\sigma_{t,n}$	$H'_n - [P'_n] - [Q'_n]$ - P'_n	$\sigma_{r,n}$	$\sigma_{t,n}$	$\sigma_{r,n}$	$\sigma_{t,n}$
a	0.5000	4.3750	29.300×10^8	8.6780×10^{-6}	235										
2	.6250	4.3750	29.300	8.6770	237	8.91×10^{-6}	0×10^{-6}	8.91×10^{-6}	3,618	3,616				3,780	3,780
3	.7500	4.3750	29.300	8.6790	238	9.15	0	9.15	3,598	3,575	8.91×10^{-6}			3,785	3,509
4	1.0000	4.3750	29.300	8.6840	241	27.20	0	27.20	3,537	3,160	9.15			3,672	3,294
5	1.2500	4.3750	29.200	8.6880	244	27.03	0	27.03	3,564	2,829	27.20			3,498	2,662
6	1.5000	4.3750	29.200	8.6930	247	27.30	0	27.30	3,140	1,958	27.03			3,274	2,090
7	2.0000	4.3750	29.200	8.7010	252	45.48	0	45.48	2,897	1,408	27.30			3,030	1,536
8	3.0000	3.8400	29.100	8.7190	263	100.44	0	100.44	2,417	557	45.48			2,551	690
9	4.0000	3.2750	29.100	8.7370	274	100.84	0	100.84	1,785	-1,301	100.44			1,876	-1,160
10	5.0000	2.6800	29.000	8.7560	286	110.28	0	110.28	933	-3,144	100.84			1,106	-2,920
11	5.5000	2.3720	29.000	8.7640	291	45.11	0	45.11	2	-5,280	110.28			207	-6,087
12	6.0000	2.1000	28.900	8.7730	297	55.28	0	55.28	-845	-6,093	45.11			-317	-6,907
13	6.5000	2.1600	28.900	8.7820	302	46.58	0	46.58	-1,108	-7,185	55.28			-668	-8,991
14	7.0000	2.1550	28.900	8.7910	308	55.46	0	55.46	-1,559	-8,043	46.58			-1,398	-7,843
15	7.5000	2.7000	28.800	8.7990	313	48.45	0	48.45	-2,140	-9,150	55.46			-1,900	-8,947
16	8.0000	2.7000	28.800	8.8090	319	55.98	0	55.98	-2,168	-9,819	46.48			-1,974	-9,831
17	8.2500	2.5500	28.800	8.8140	328	28.04	167.16	-139.12	-2,676	-10,899	55.98			-3,488	-10,702
18	8.5000	2.3800	28.800	8.8170	324	18.60	858.97	-840.37	-3,085	-8,756	-139.12			-2,824	-8,564
19	8.7500	2.1450	28.800	8.8220	327	28.09	1333.5	-1305.4	-3,000	17,132	-840.37			-2,785	17,329
20	9.0000	1.9100	28.800	8.8260	330	27.79	2182.5	-2154.7	-2,197	53,534	-1305.4			-1,959	53,740
									0	118,600	-1461.0			0	93,672

TABLE VII. - ABRIDGED VALUES FROM CALCULATION OF STRESS DISTRIBUTION FOR EXAMPLE VII

	1	2	3	4	5	6	7	25	25a	25b	38	39	54	60	61
n	r_n	h_n	E_n	ν_n	ΔT_n	H'_n	$[P'_n][Q'_n]$	$H'_n - [P'_n][Q'_n]$	$\sigma_{r,n}$	$\sigma_{t,n}$	$H'_n - [P'_n][Q'_n]$ $- P'_n$	$\sigma_{r,n}$	$\sigma_{t,n}$		
a	0.5000	4.3750	Constant at 30.000×10^6	Constant at 8.2970×10^{-6}	Constant at 0	Constant at 0	0×10^{-6}	0×10^{-6}	-2,468	-2,468	0×10^{-6}	-2,356	-2,356		
2	.6250	4.3750							-2,468	-2,468		-2,356	-2,356		
3	.7500	4.3750							-2,468	-2,468		-2,356	-2,356		
4	1.0000	4.3750							-2,468	-2,468		-2,356	-2,356		
5	1.2500	4.3750							-2,468	-2,468		-2,356	-2,356		
6	1.5000	4.3750							-2,468	-2,468		-2,356	-2,356		
7	2.0000	4.3750							-2,468	-2,468		-2,356	-2,356		
8	3.0000	3.8400							-2,468	-2,468		-2,356	-2,356		
9	4.0000	3.2750							-2,779	-2,614		-2,553	-2,498		
10	5.0000	2.6800							-3,183	-2,849		-3,039	-2,780		
11	5.5000	2.3780	Constant at 50.000×10^6	Constant at 8.2970×10^{-6}	Constant at 0	Constant at 0	0×10^{-6}	0×10^{-6}	-3,779	-3,193	0×10^{-6}	-3,608	-3,049		
12	6.0000	2.2100							-4,802	-3,428		-4,012	-3,273		
13	6.5000	2.1600							-4,437	-3,604		-4,237	-3,442		
14	7.0000	2.1550							-4,475	-3,708		-4,273	-3,537		
15	7.5000	2.7000							-4,432	-3,762		-4,232	-3,592		
16	8.0000	2.7000							-3,518	-2,476		-3,359	-3,319		
17	8.2500	2.5500							-3,515	-3,479		-3,356	-3,321		
18	8.5000	2.3800							-3,644	1,358		-3,476	1,519		
19	8.7500	2.1450							-3,378	26,512		-3,199	26,677		
b	9.0000	1.9100							-2,292	65,023		-2,083	65,196		
									0	107,180		0	91,168		

TABLE VIII. - CALCULATION OF STRESS DISTRIBUTION FOR PARALLEL-SIDED DISK

(a) Abridged values

	1	2	3	4	5	6	7	25	25a	25b	38	39	40	41	60	61
n	r_n	h_n	E_n	ν_n	ΔT_n	H'_n	$[P'_n][Q'_n]$	$H'_n - [P'_n][Q'_n]$	$\sigma_{r,n}$	$\sigma_{t,n}$	σ_y	$\sigma_{e,n}$	$\sigma_{r,n}$	$\sigma_{t,n}$		
a	0.5000	Constant at 1.0000	Constant at 30.000×10^6	Constant at 8.2970×10^{-6}	Constant at 0	Constant at 0	Constant at 0	Constant at 0	0	176,040	Constant at 100,000	176,040	0	124,580		
2	.6250								31,650	142,520		129,620	84,952	127,160		
3	.7500								48,400	124,880		109,030	41,519	124,510		
4	1.0000								84,873	106,350		92,802	60,031	111,630		
5	1.5000								74,394	91,900		84,518	72,849	93,977		
6	2.0000								75,607	88,873		81,704	74,825	87,813		
7	2.5000								74,187	83,268		79,119	73,589	84,005		
8	3.0000								71,389	80,278		76,215	70,978	80,803		
9	3.5000								67,553	77,268		72,898	67,282	77,669		
10	4.0000								62,892	74,060		69,156	62,700	74,360		
11	4.5000	Constant at 1.0000	Constant at 30.000×10^6	Constant at 8.2970×10^{-6}	Constant at 0	Constant at 0	Constant at 0	Constant at 0	57,471	70,579	Constant at 100,000	66,024	57,532	70,845		
12	5.0000								51,322	66,782		60,551	51,223	67,009		
13	5.5000								44,473	62,650		55,827	44,401	62,847		
14	6.0000								36,934	58,163		50,979	38,883	58,339		
15	6.5000								28,711	53,317		46,219	28,878	53,476		
16	7.0000								19,813	48,103		41,873	19,792	48,849		
17	7.5000								10,248	42,818		38,433	10,232	42,654		
b	8.0000								0	36,562		36,562	0	36,919		



TABLE VIII. - CALCULATION OF STRESS DISTRIBUTION FOR PARALLEL-SIDED DISK - Concluded

(b) Calculation for first approximation of plastic-stress distribution

	42	43	44	45
n	(9)/(1)	(9)/(1) _{n-1}	1+(42)	1-(43)
a				
2	0.10000	0.12500	1.1000	0.87500
3	.08333	.10000	1.0833	.90000
4	.12500	.15670	1.1250	.83333

	46	46a	47	48	49	50	51	52	53
n	$\epsilon_{p,n}$ (graph reading, fig. 7)	$\epsilon_{p,n}$ (estimate)	Δr_n $\frac{(46a)}{(41)x2} \times$ $\frac{(41)x2}{[2(38)-(39)]}$	Δt_n $\frac{(46a)}{(41)x2} \times$ $\frac{(41)x2}{[2(39)-(38)]}$	(47)x(42)	(47) _{n-1} x(43)	(48)x(44)	(48) _{n-1} x(45)	P' _n (49)+(50)- (51)+(52)
a	1800x10 ⁻⁶	1800x10 ⁻⁶	-900.00x10 ⁻⁸	1800.00x10 ⁻⁸					
2	550	550	-168.08	537.56	-18.808x10 ⁻⁶	-112.50x10 ⁻⁶	591.32x10 ⁻⁶	1575.0x10 ⁻⁶	884.37x10 ⁻⁸
3	300	300	-58.59	278.25	-3.2158	-18.805	300.02	483.80	153.75
4	0	0	0	0	0	-8.4530	0	250.78	824.34

	54	55	56	57	58	59	60	61	62
n	H' _n - [P' _n] - [Q' _n] - P' _n (25b) - (53)	M' _n [(54)x(10)+ (14)x(81)] + (26)	M' _n [(54)x(8)+ (14)x(20)] + (26)	B _{r,n} (27)x(57) _{n-1} + (88)x(58) _{n-1} + (56)	B _{t,n} (29)x(57) _{n-1} + (30)x(58) _{n-1} + (56)	$\sigma_{t,a}$ [$\sigma_{r,b}$ - (57) _b] + (33) _b	$\sigma_{r,n}$ (33)x(59) + (57)	$\sigma_{t,n}$ (34)x(59) + (58)	$\sigma_{\theta,n}$ $\sqrt{(60)^2 + (61)^2}$ - (60)x(61)
a									
2	-854.37x10 ⁻⁶	2,144.1	23,499	2,144.1	23,499	Constant at 138,510	0	138,510	138,510
3	-183.75	117.81	4,475.8	5,539.1	24,590		27,816	135,700	124,390
4	-824.34	101.23	5,829.7	9,836.0	25,875		43,881	122,980	107,930
5	0	-1,878.7	-795.28	12,435	19,838		61,477	109,280	95,450
6	0	-2,841.2	-1,050.8	11,484	17,021				
7	0	-3,423.3	-1,502.6	9,013.8	14,665				
8	0	-4,218.0	-1,551.8	5,667.5	12,309				
9	0	-5,005.0	-1,799.8	1,533.5	9,519.1				
10	0	-5,800.2	-2,045.1	-3,328.3	6,519.0				
11	0	-6,597.3	-2,290.8	-8,889.8	3,178.3				
12	0	-7,395.5	-2,534.7	-13,156	-518.0				
13	0	-8,194.5	-2,778.8	-22,060	-4,578.8				
14	0	-8,994.4	-3,021.9	-29,667	-9,009.6				
15	0	-9,794.5	-3,265.0	-37,923	-13,814				
16	0	-10,595	-3,507.8	-46,856	-18,994				
17	0	-11,396	-3,750.1	-56,454	-24,850				
b	0	-12,197	-3,992.5	-66,717	-30,483				

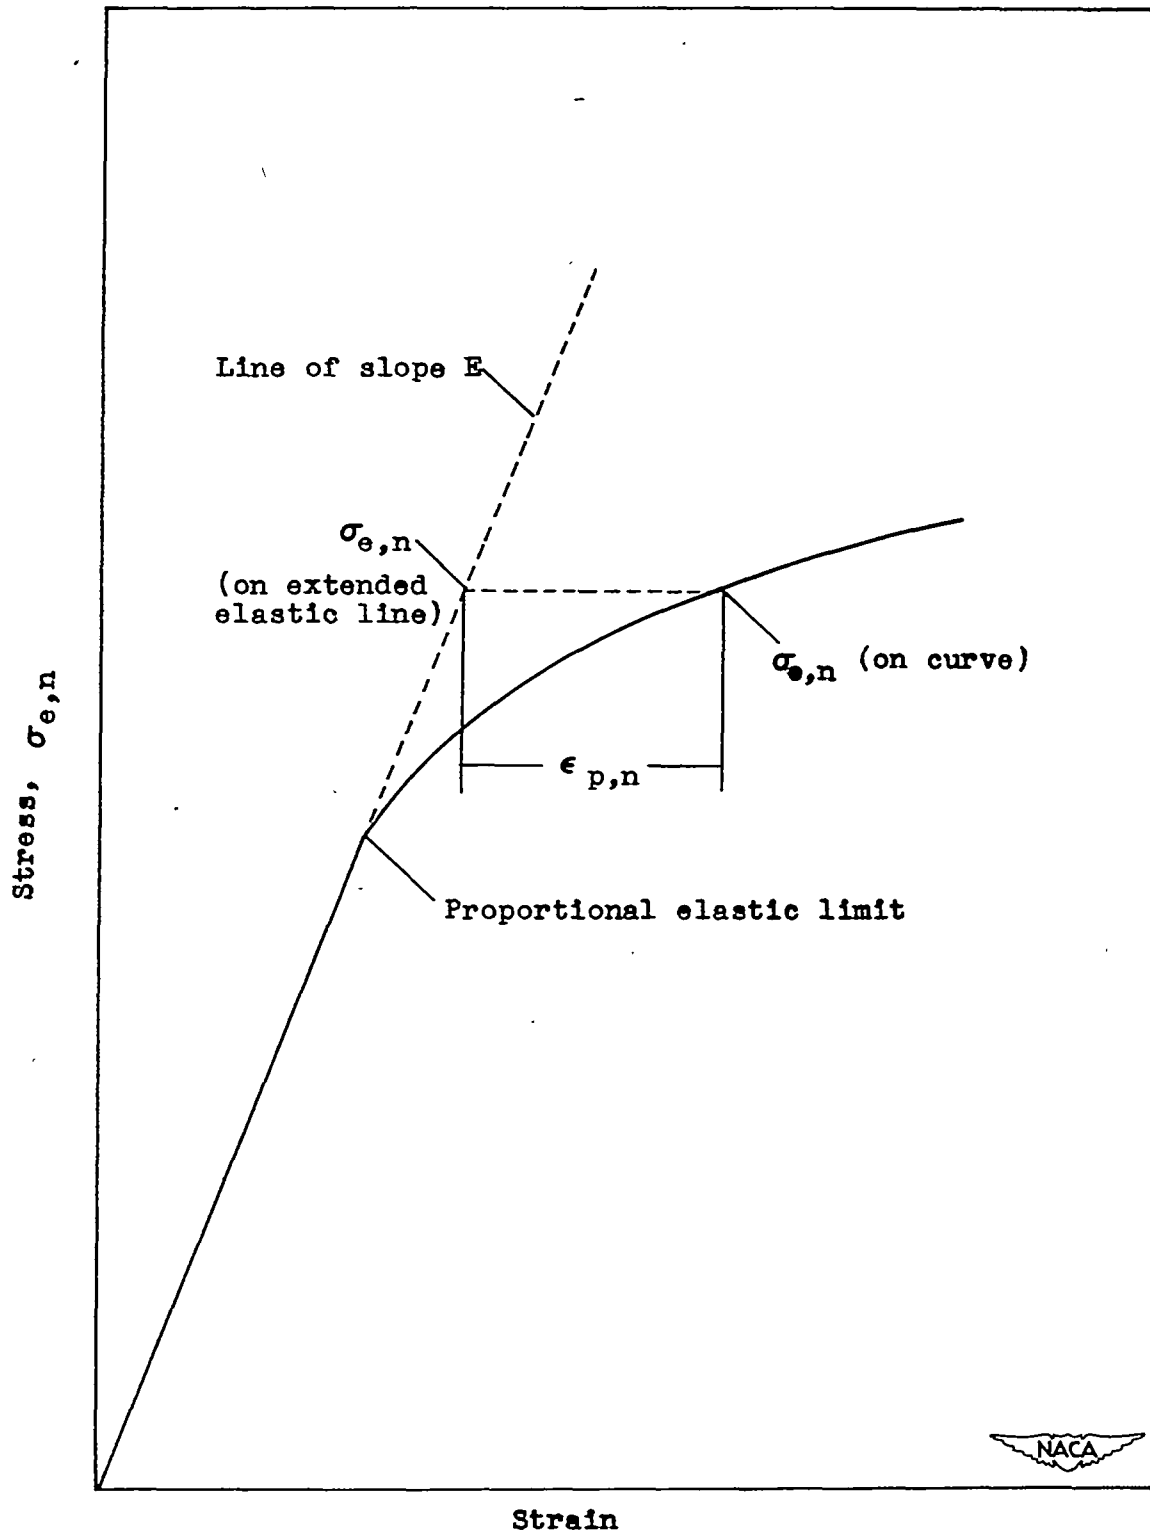


Figure 1. - Uniaxial stress-strain curve showing relation between stress $\sigma_{e,n}$ and plastic strain $\epsilon_{p,n}$.

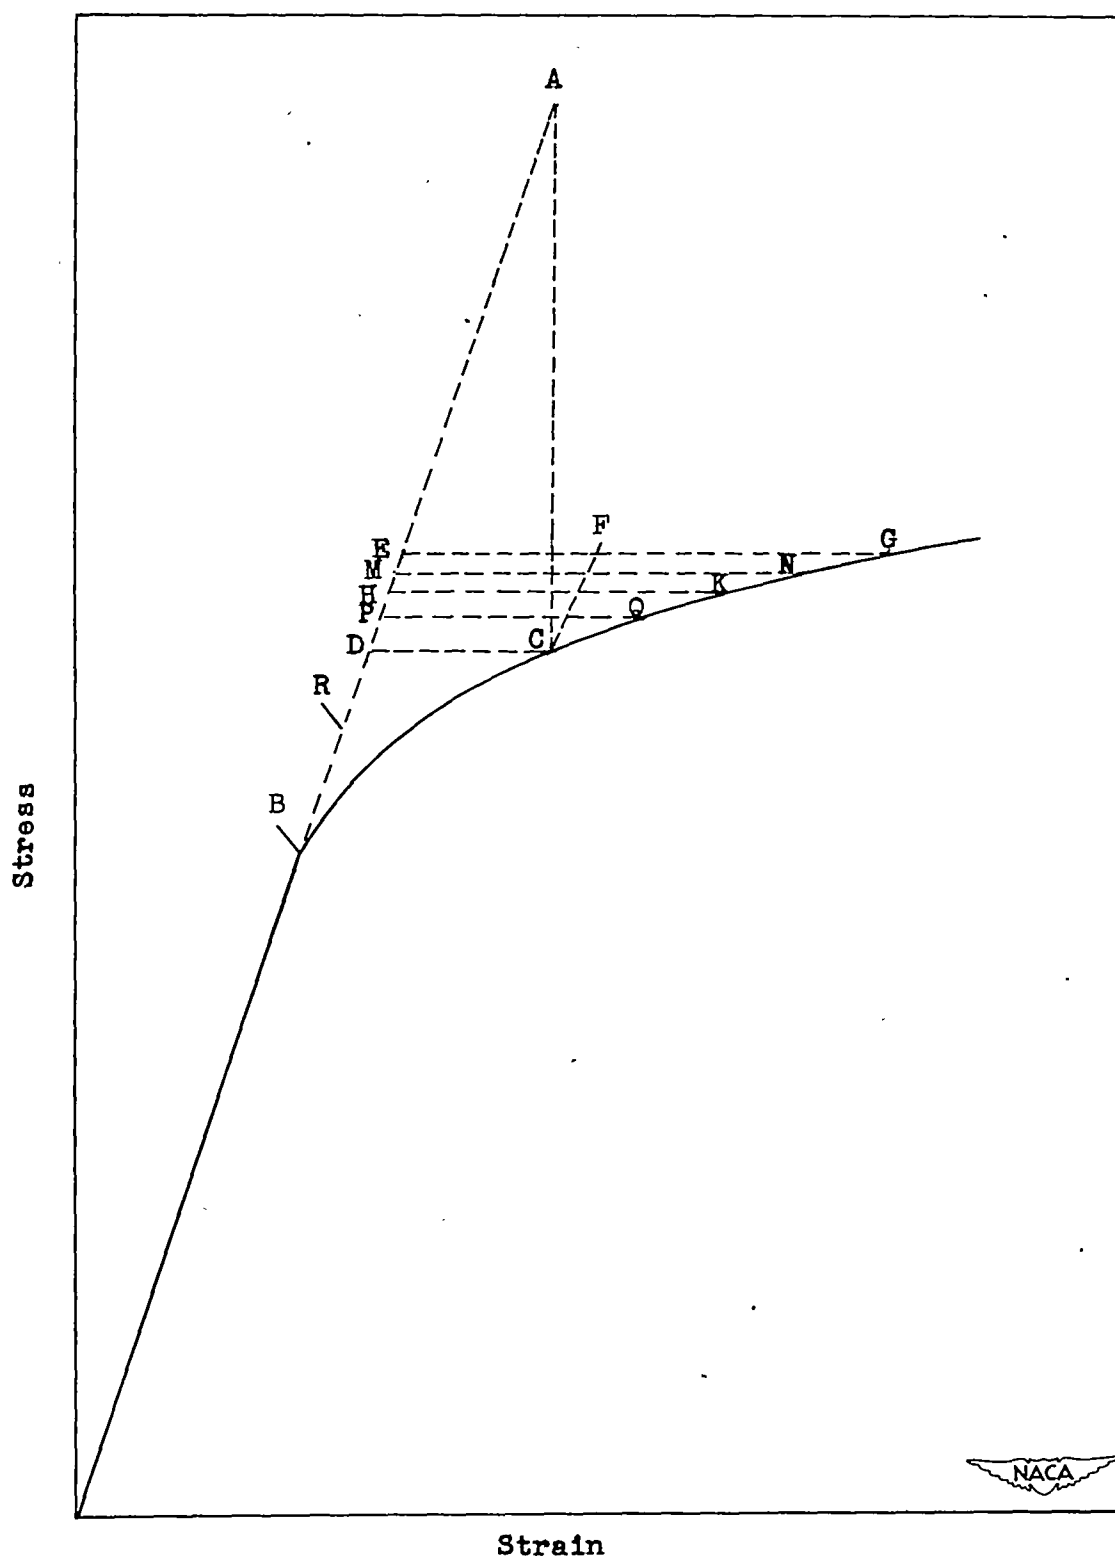


Figure 2. - Uniaxial stress-strain curve illustrating procedure used to find correct value of plastic strain.

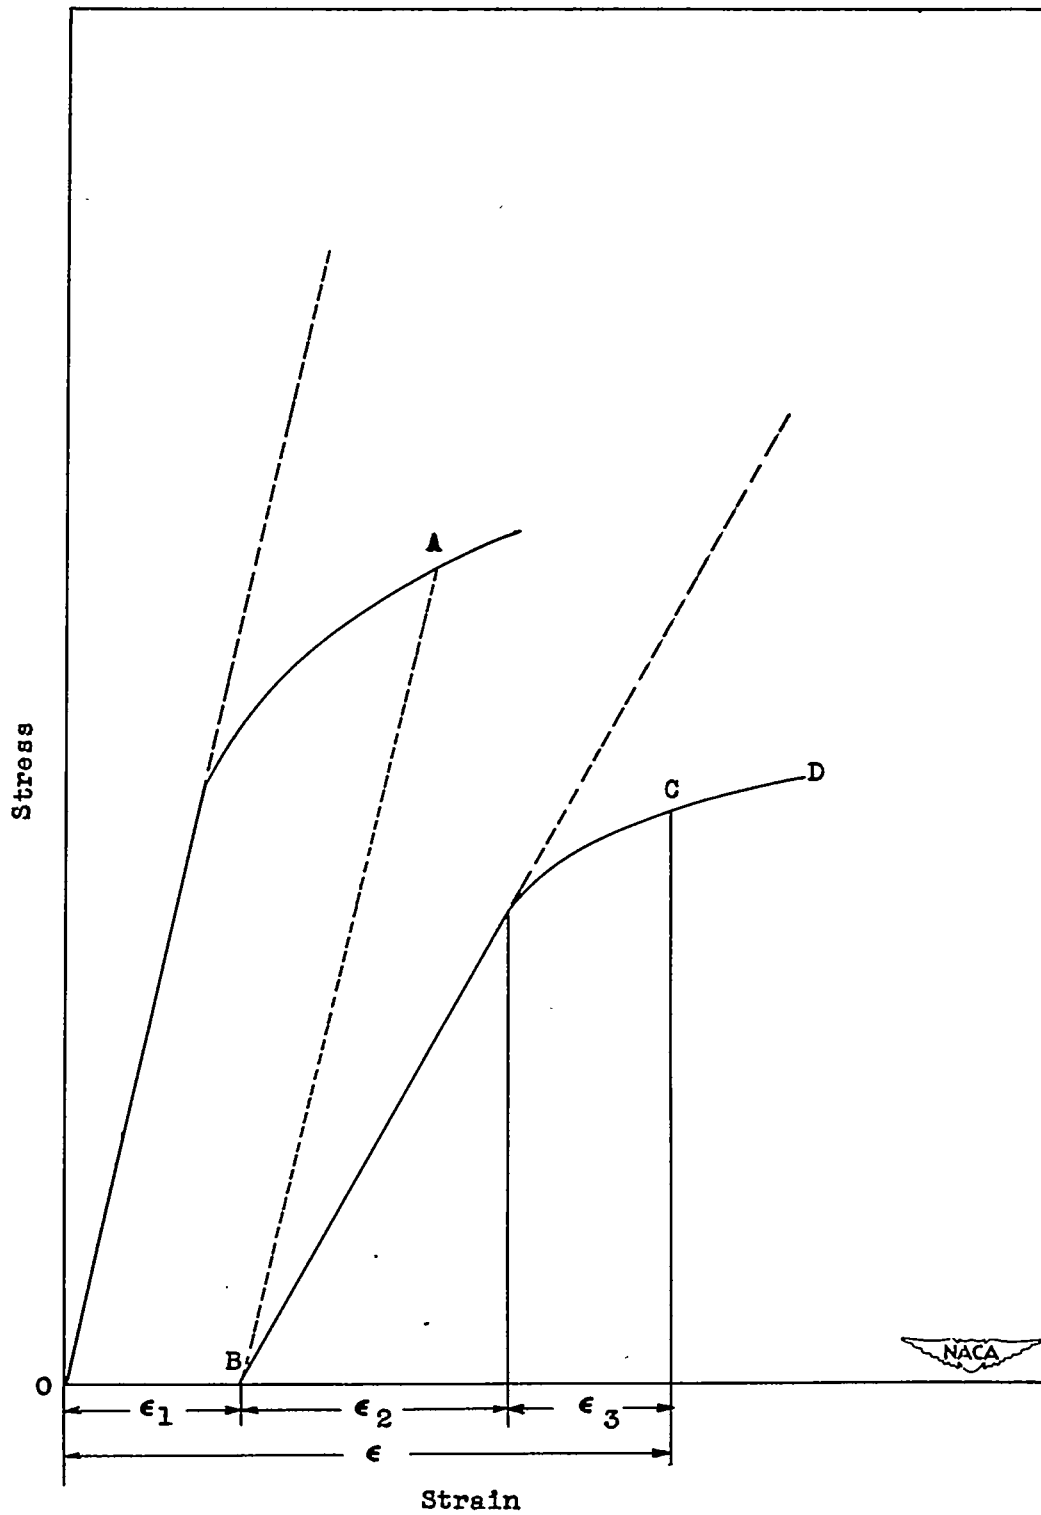


Figure 3. - Uniaxial stress-strain curves showing components of strain when plastic flow occurs a second time.

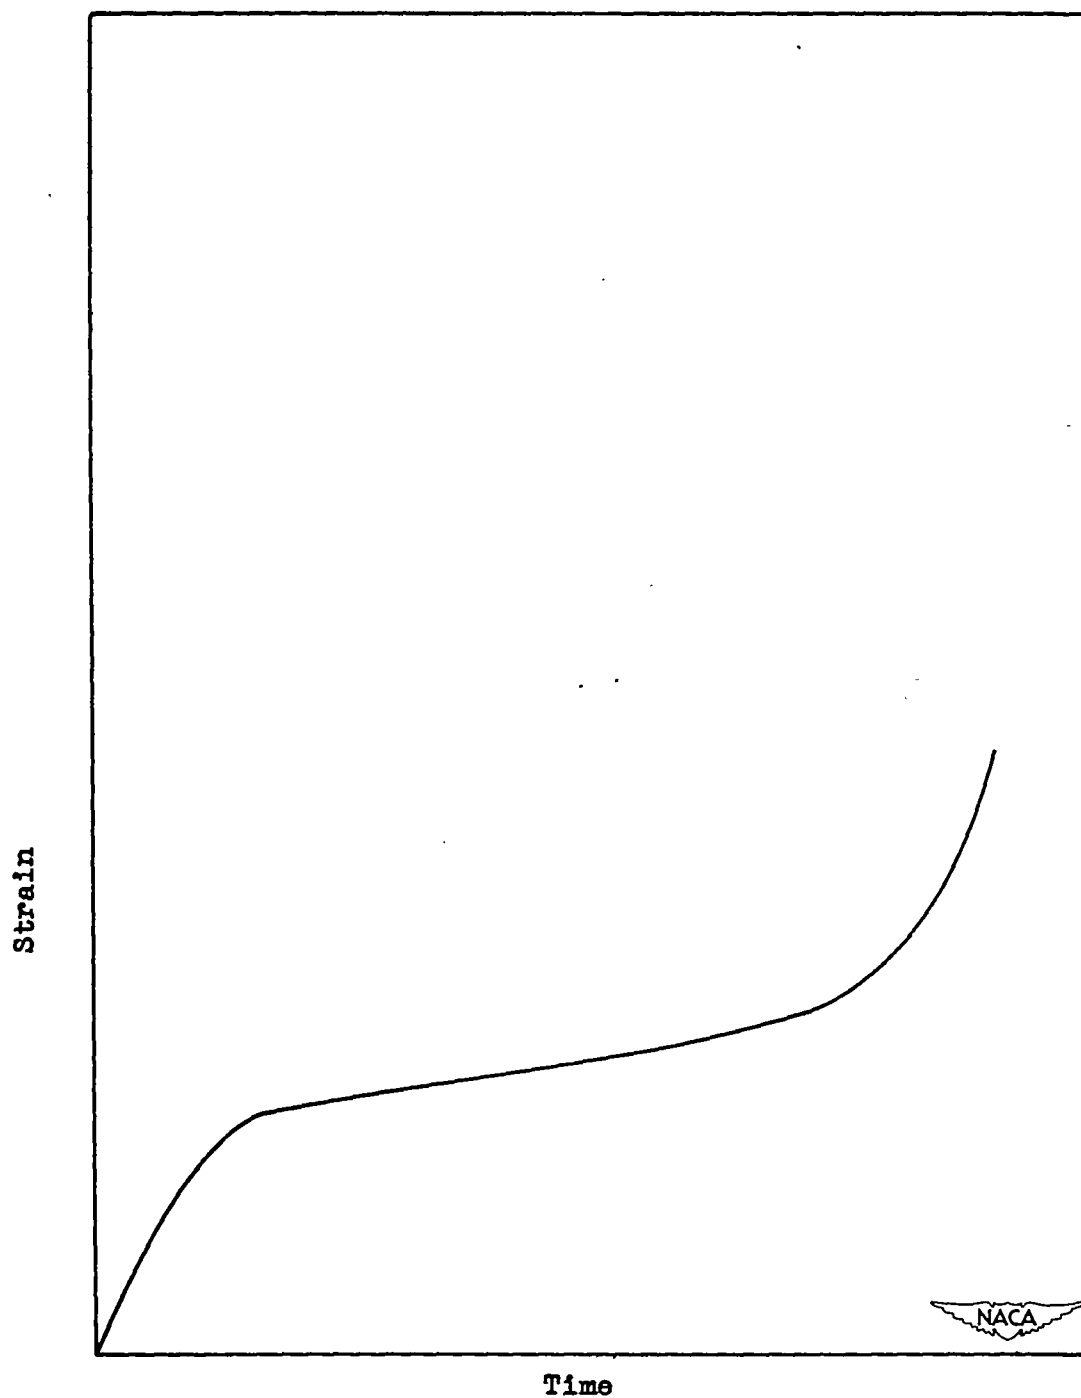


Figure 4. - Typical deformation-time curve from a constant-temperature, constant-load creep test.

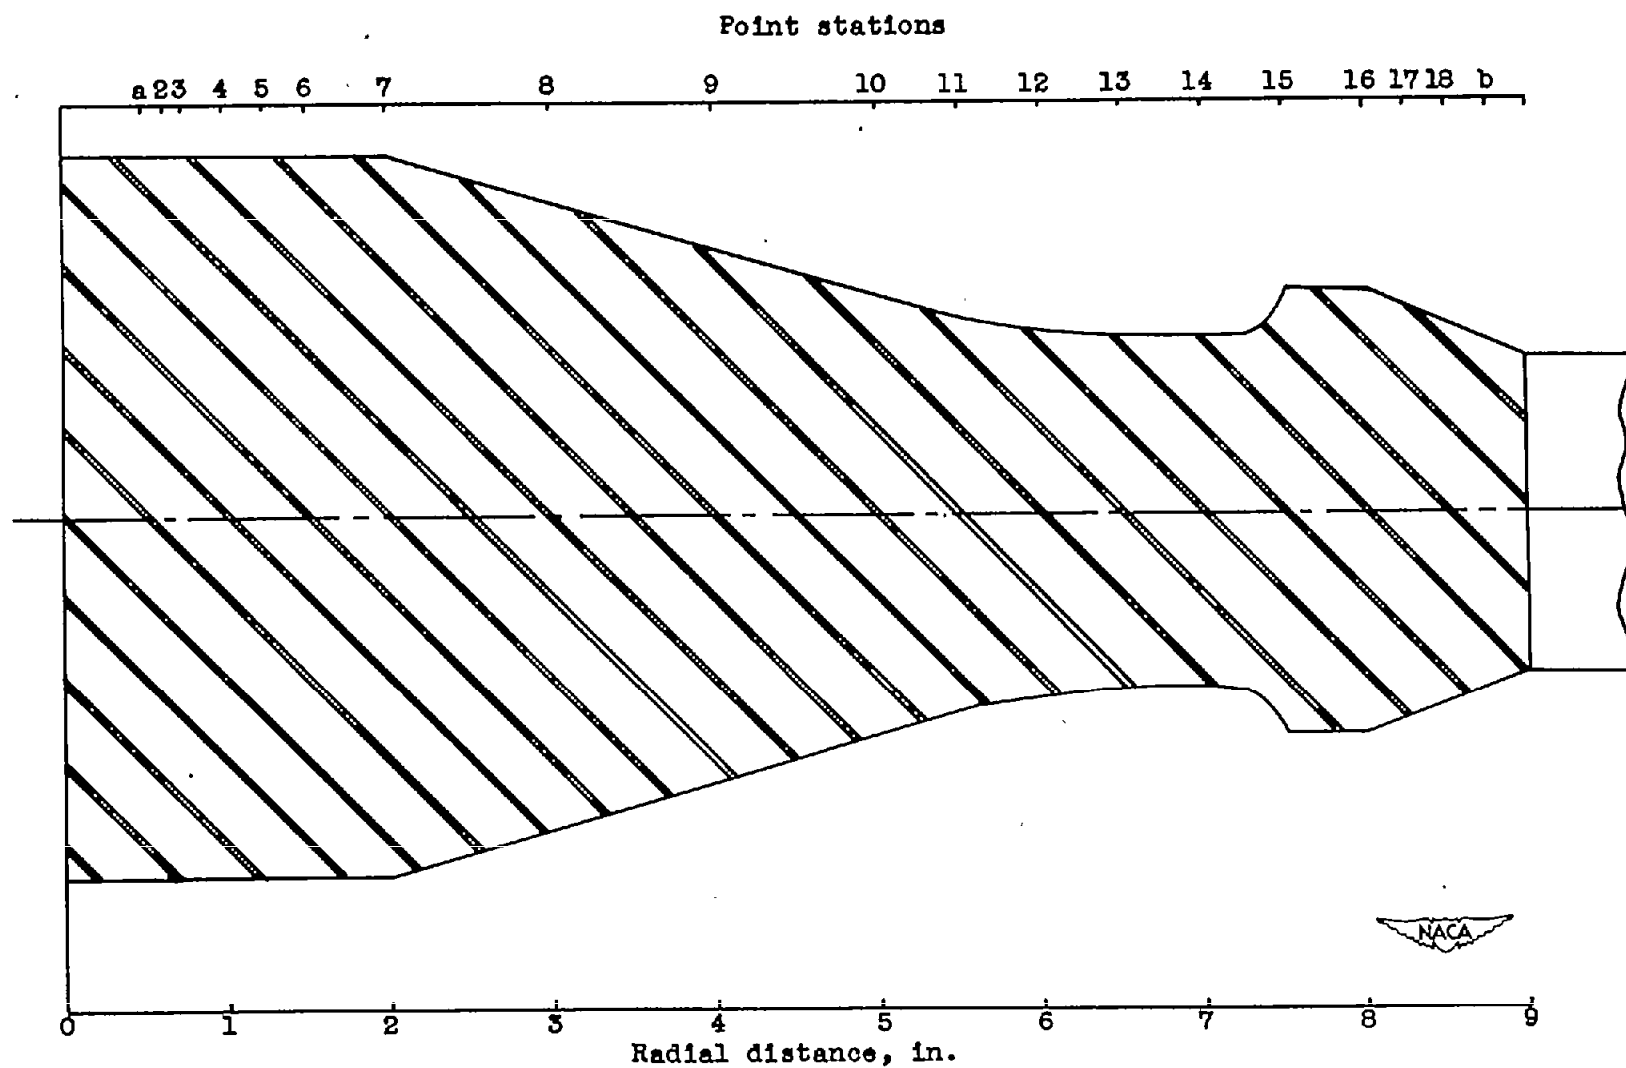


Figure 5. - Cross section of disk used for numerical examples showing location of point stations.

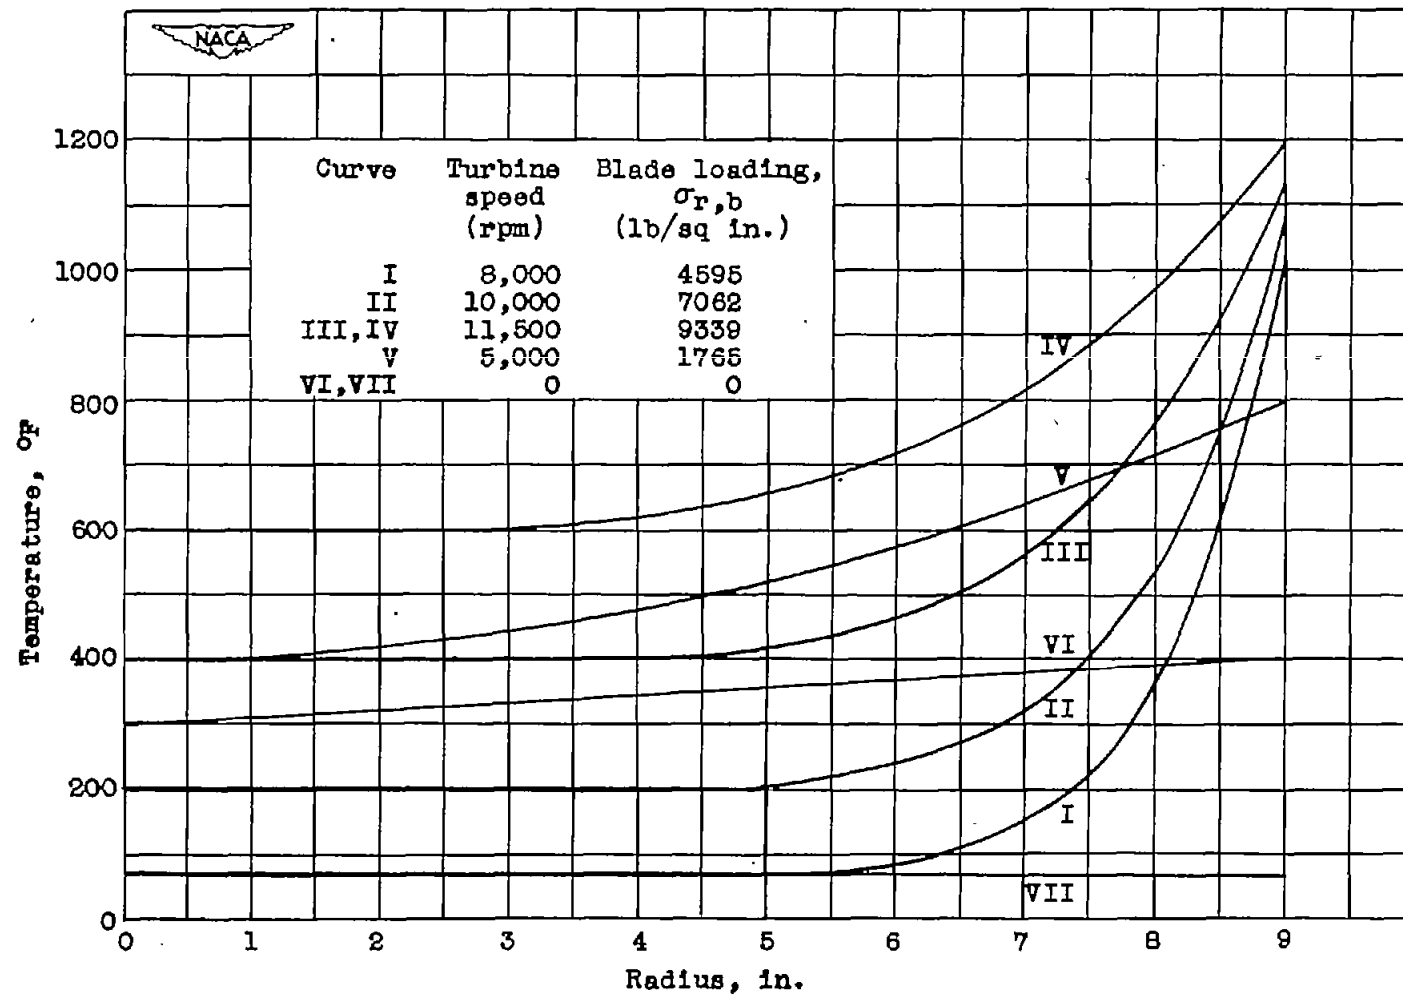


Figure 6. - Assumed temperature-distribution curves and corresponding turbine speeds. (Curves I, II, and III are consecutive starting conditions; curve IV represents steady-state operation; and curves V, VI, and VII are consecutive stopping conditions.)

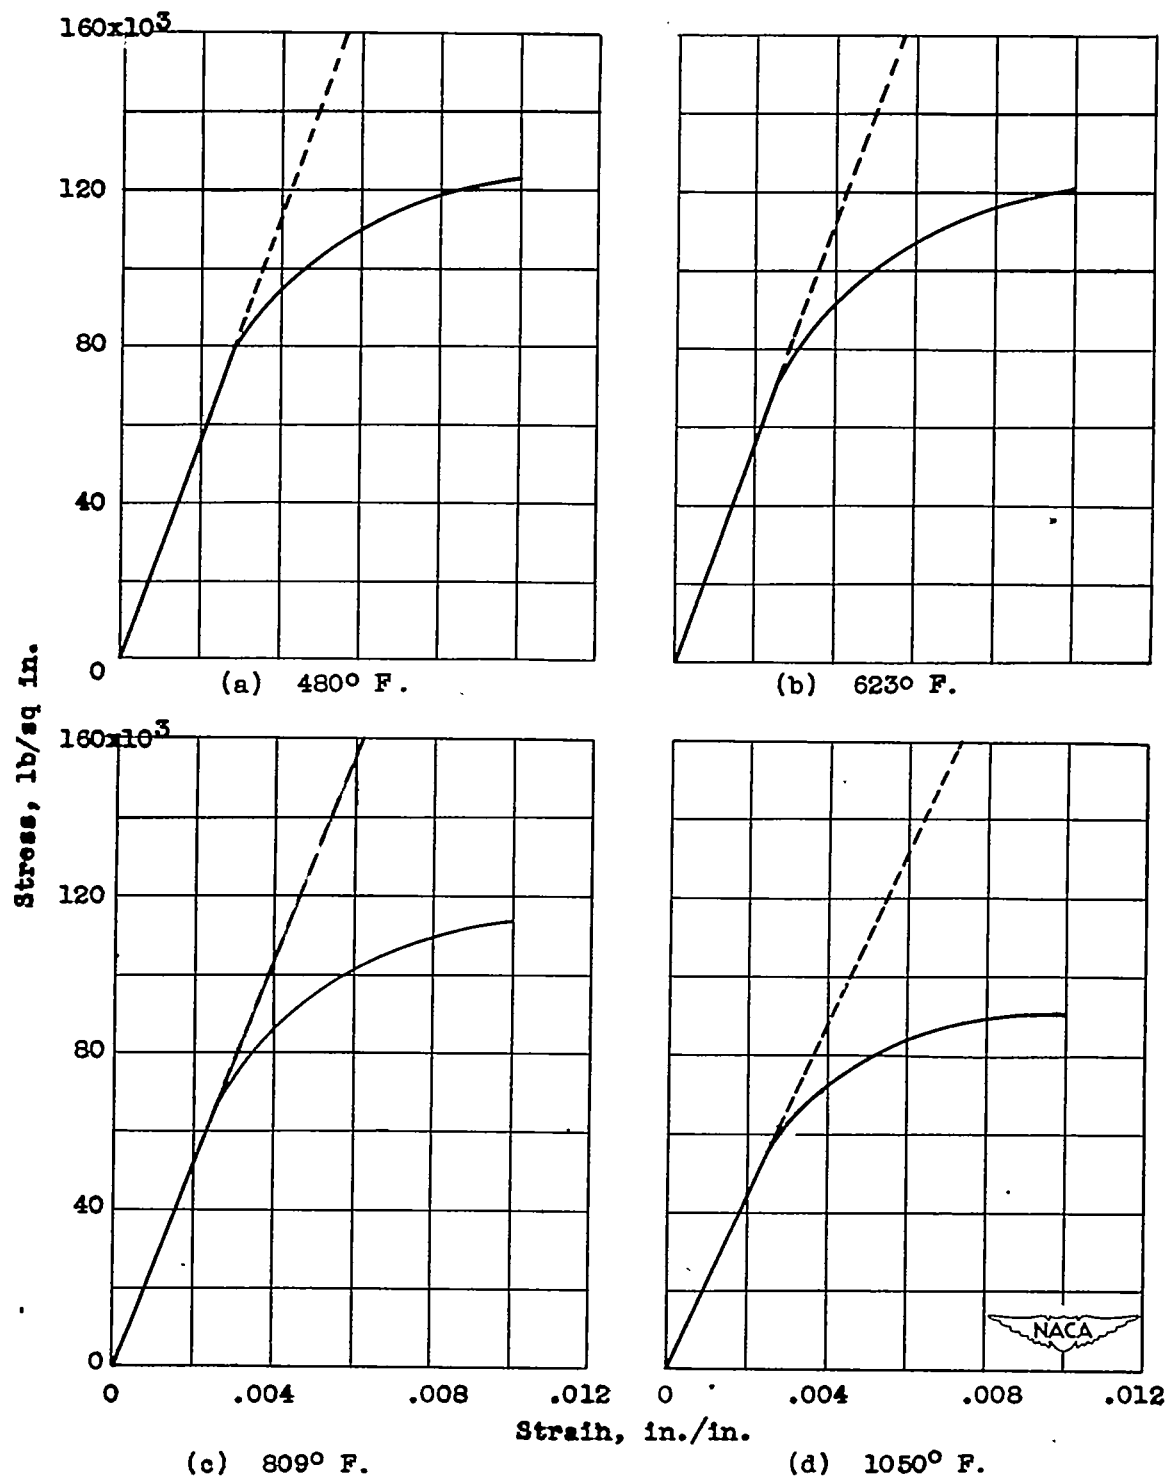


Figure 7. - Stress-strain curves of disk material for various temperatures.

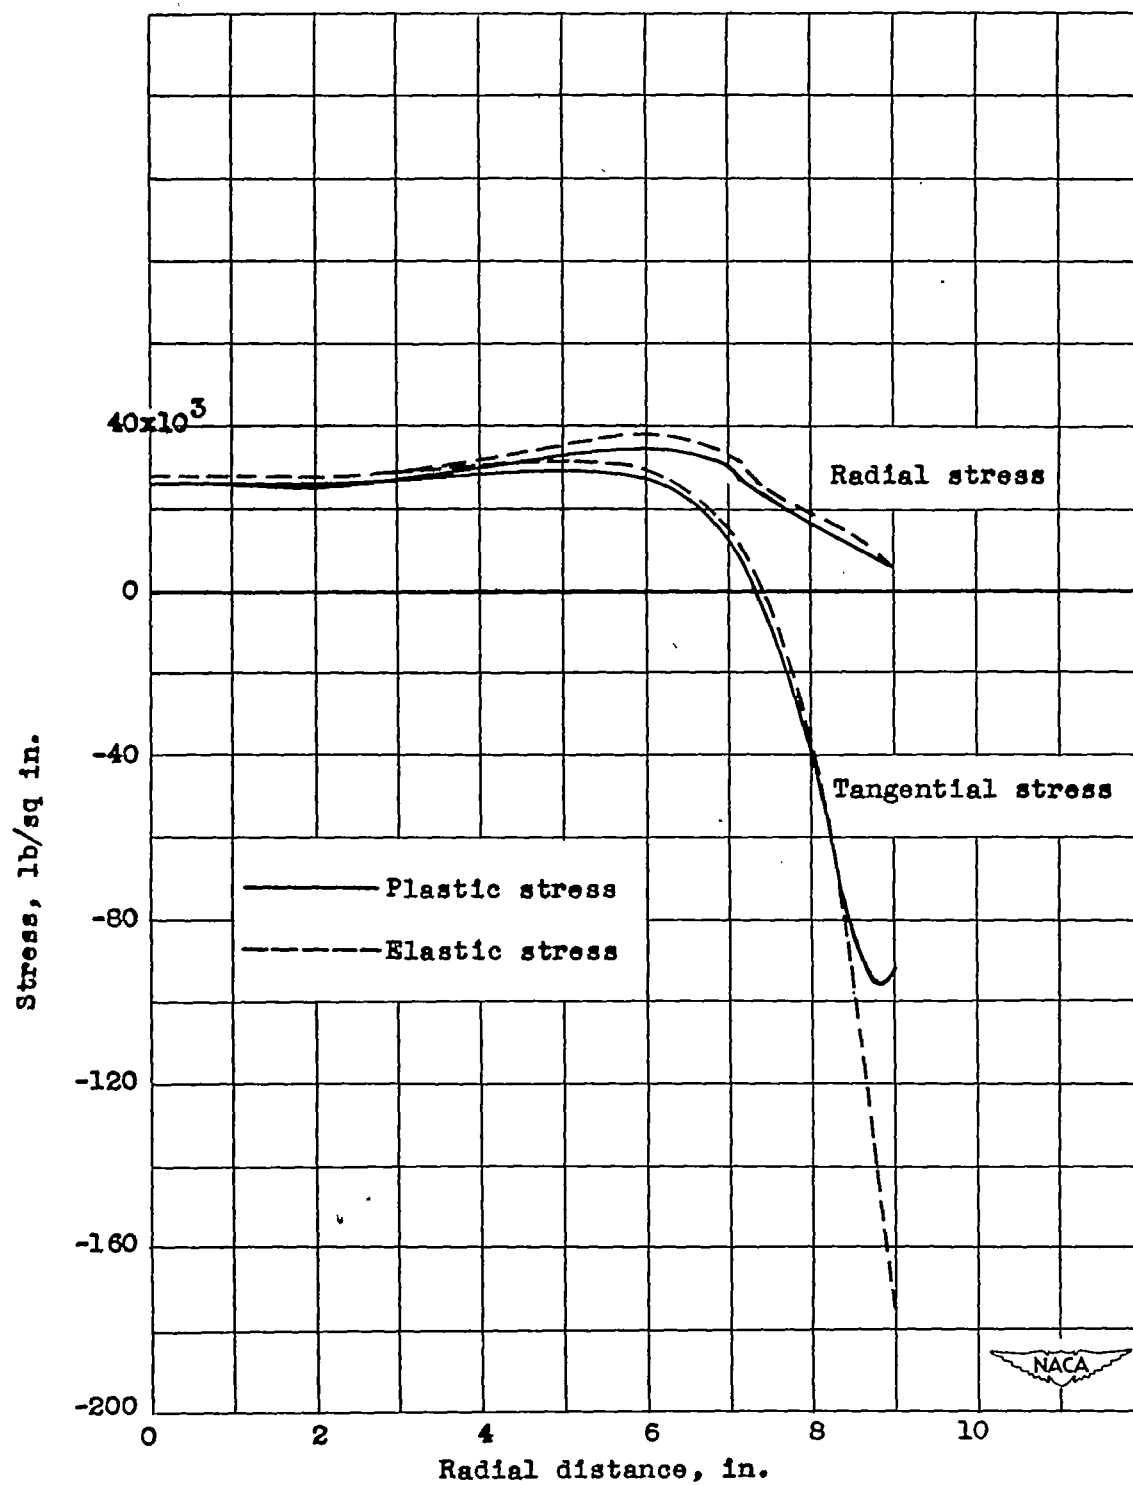


Figure 8. - Stresses in turbine disk under conditions of curve I of figure 6.

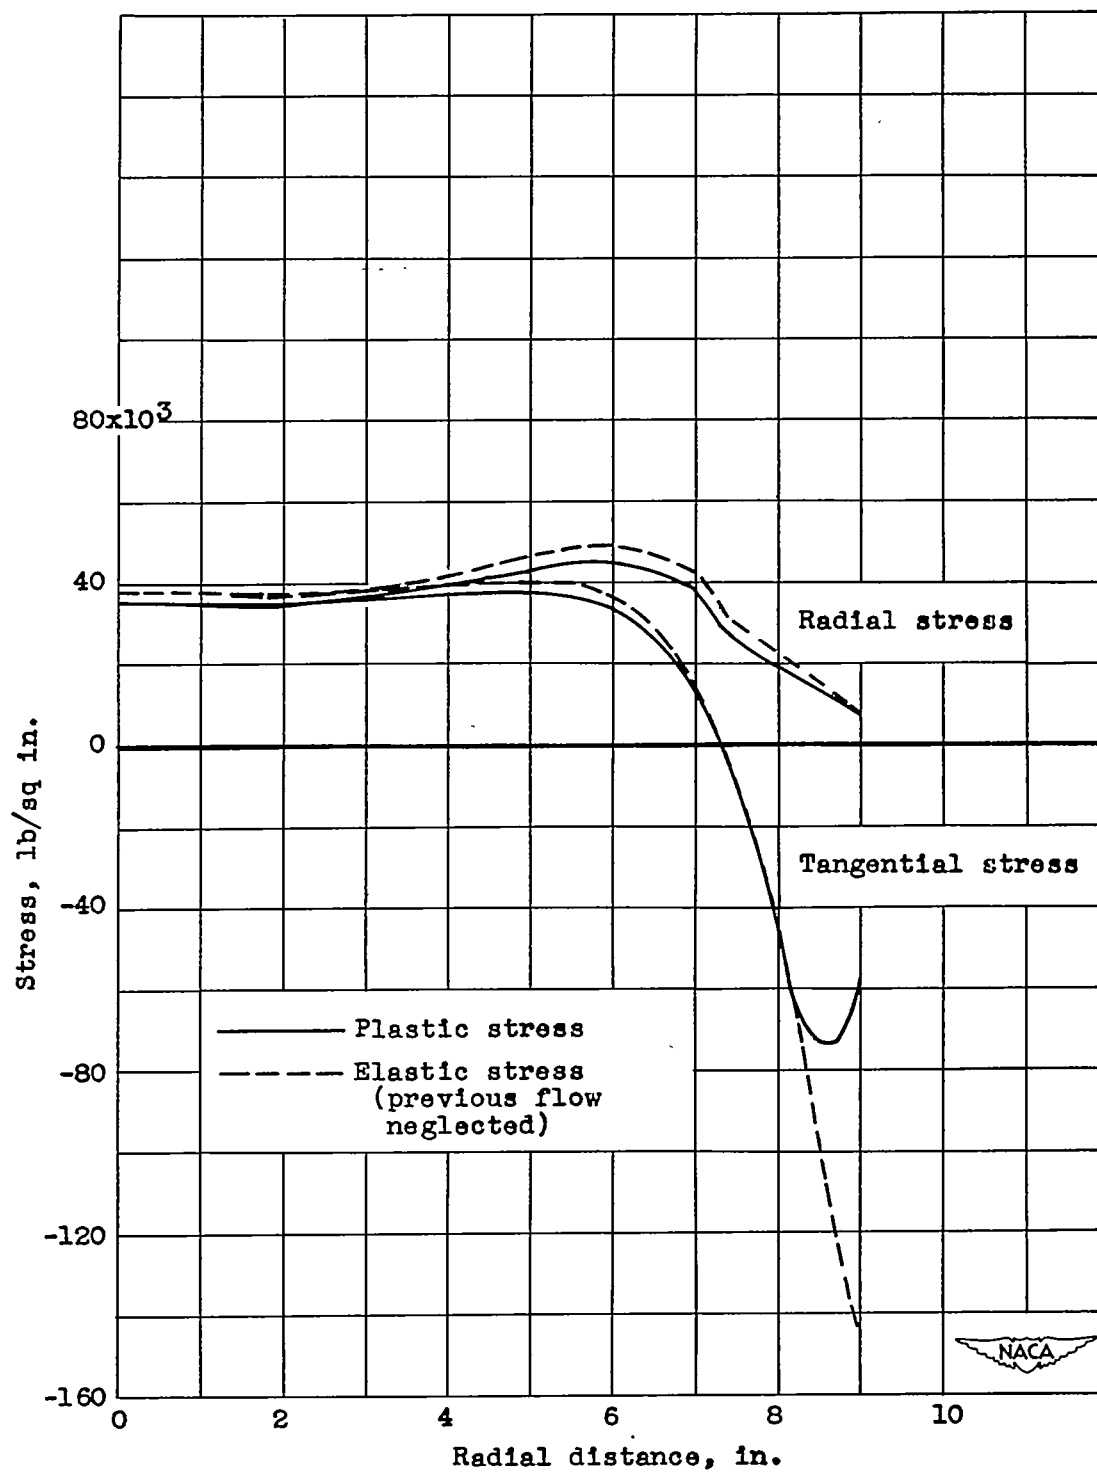


Figure 9. - Stresses in turbine disk under conditions of curve II of figure 6.

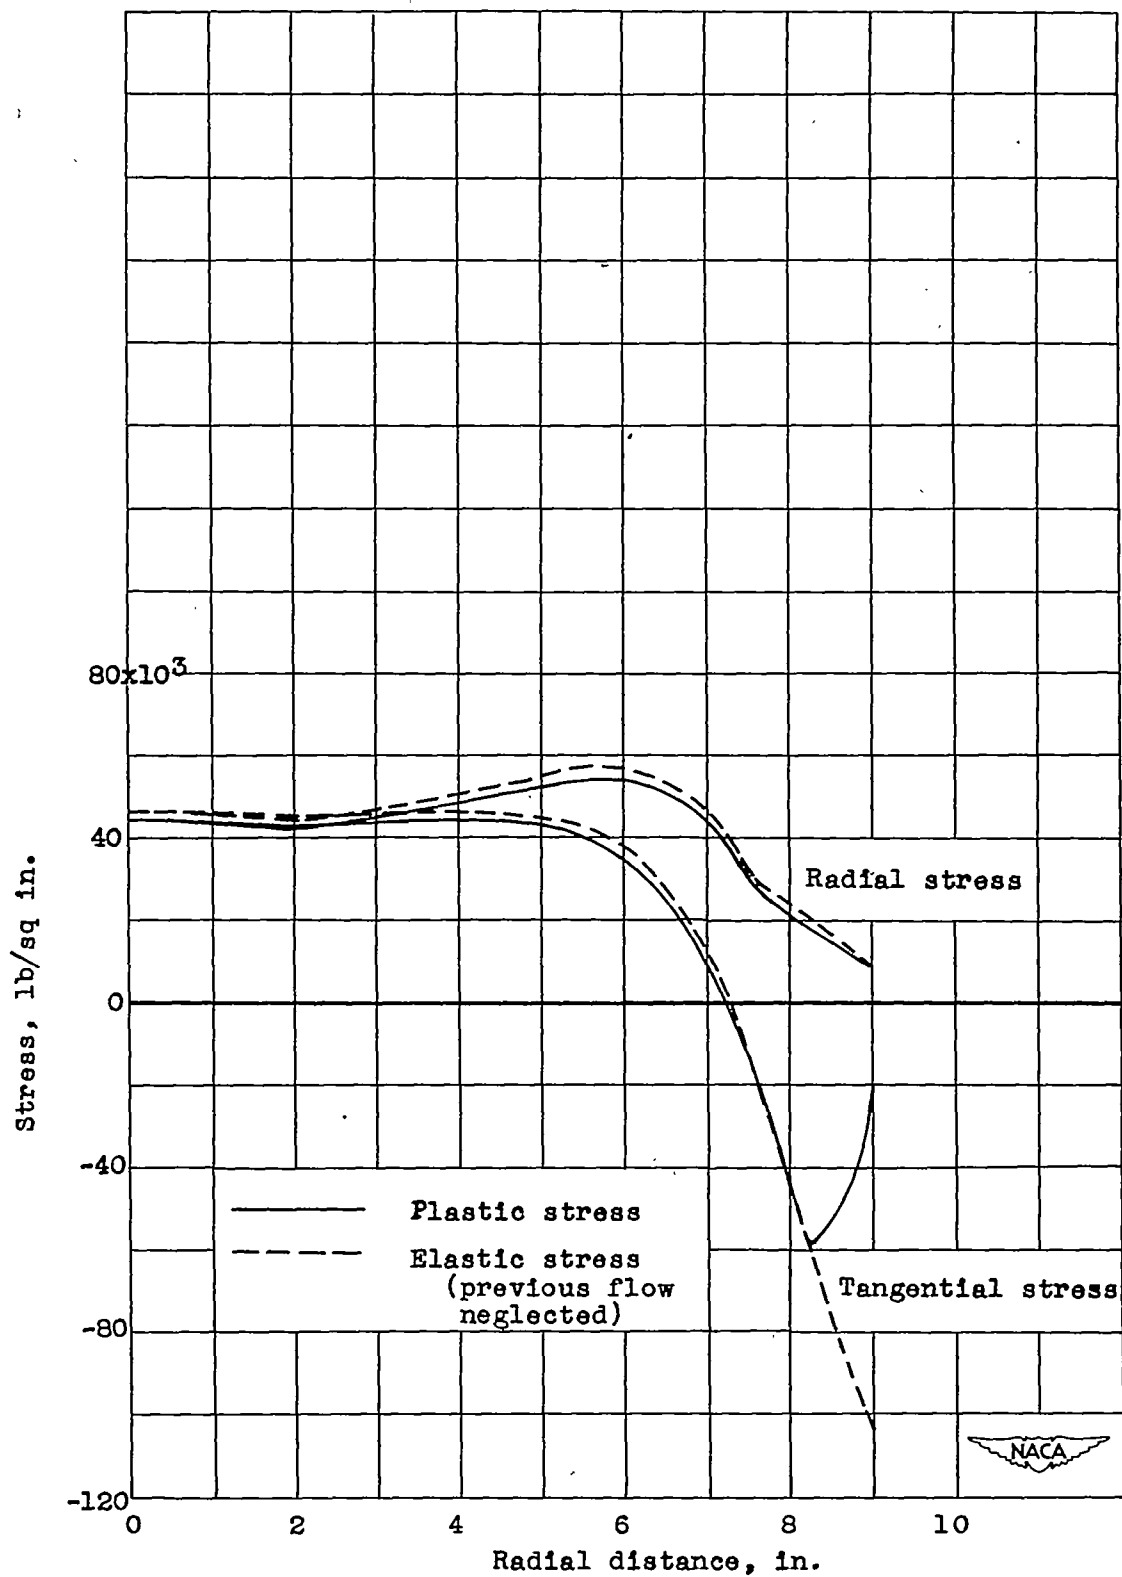


Figure 10. - Stresses in turbine disk under conditions of curve III of figure 6.

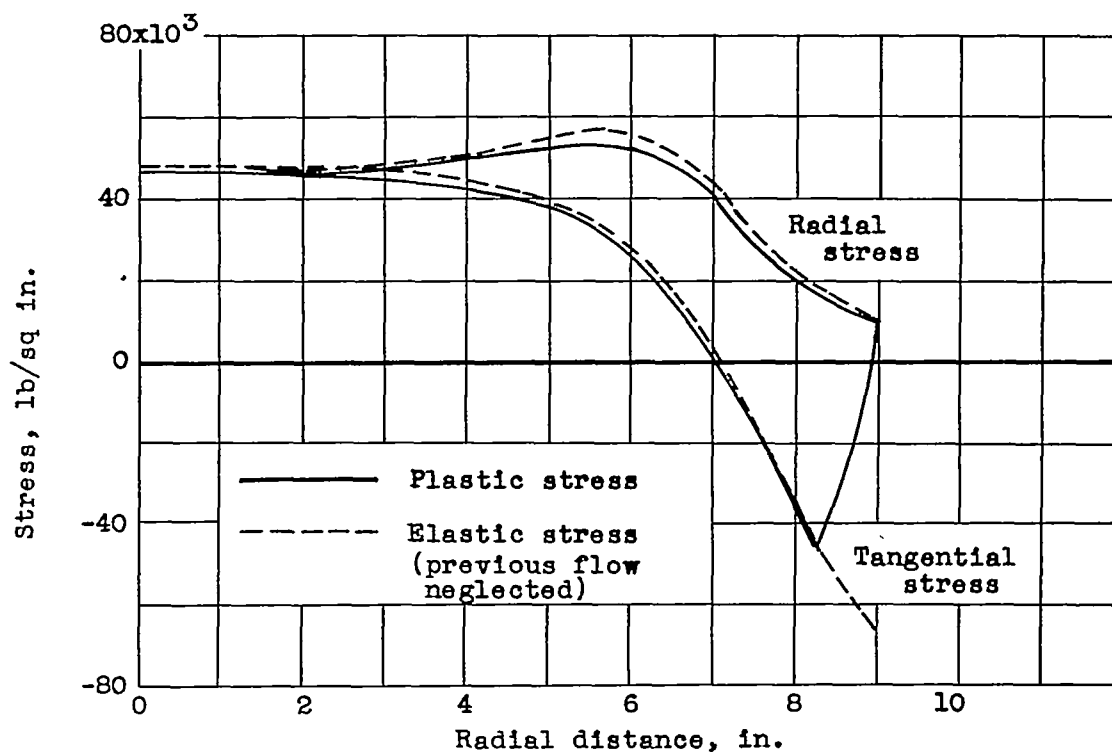


Figure 11. - Stresses in turbine disk under conditions of curve IV of figure 6. (The stresses before and after creep occurs coincide within the accuracy of this plot.)

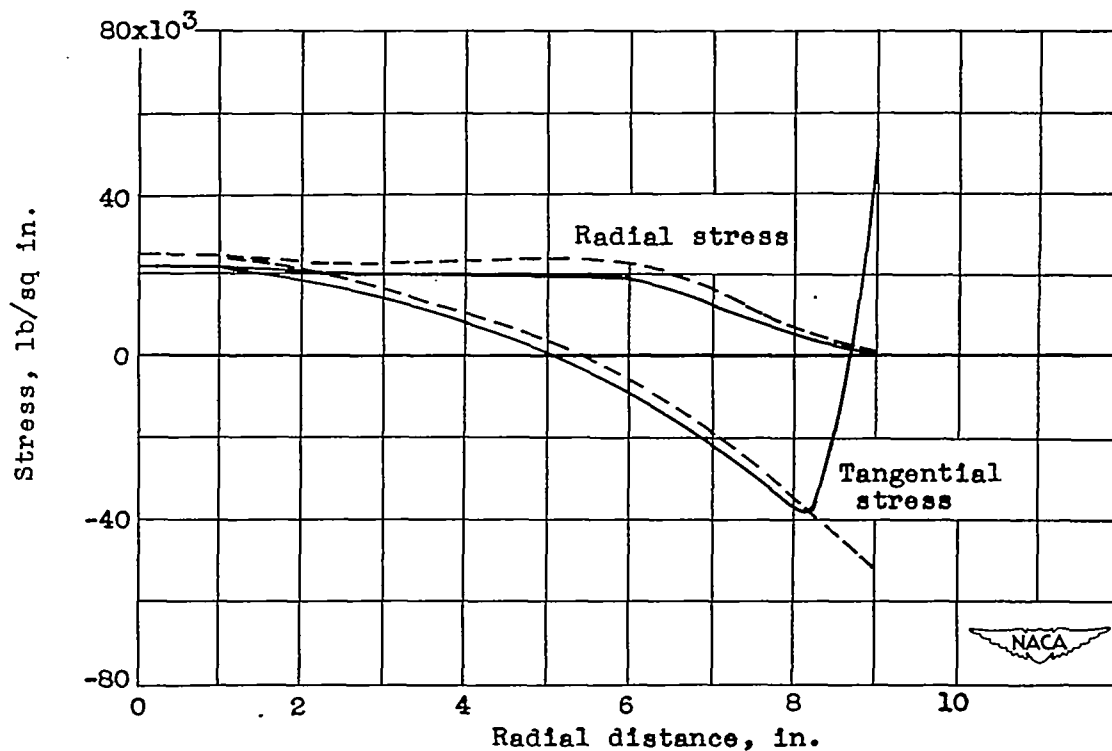


Figure 12. - Stresses in turbine disk under conditions of curve V of figure 6.

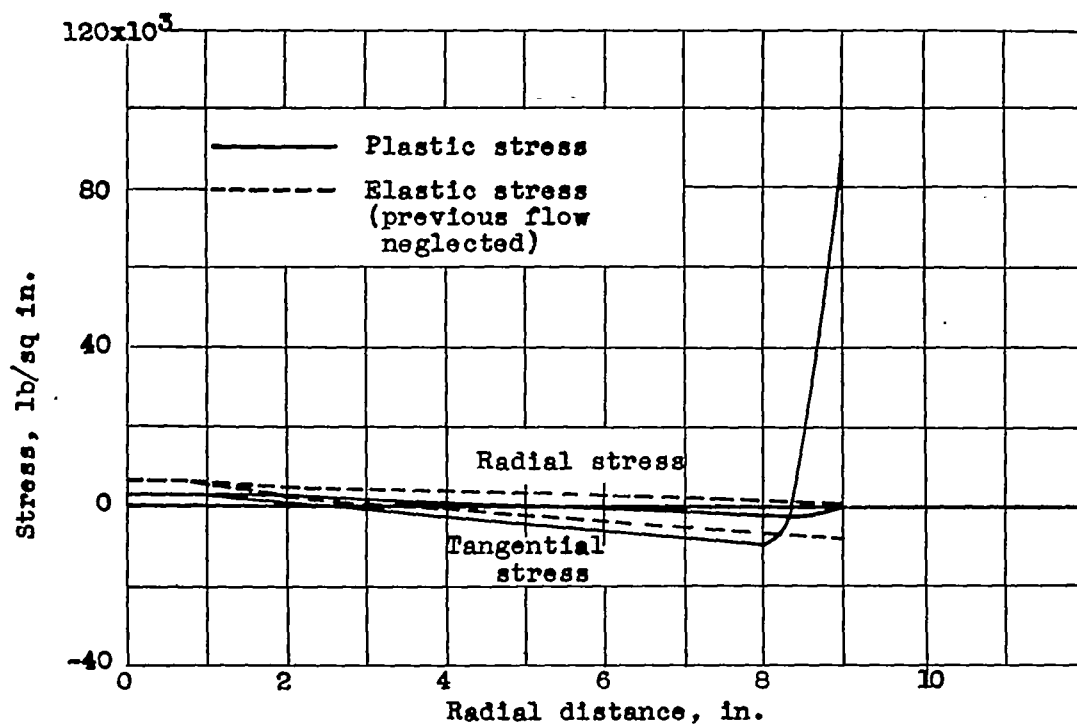


Figure 13. - Stresses in turbine disk under conditions of curve VI of figure 6.

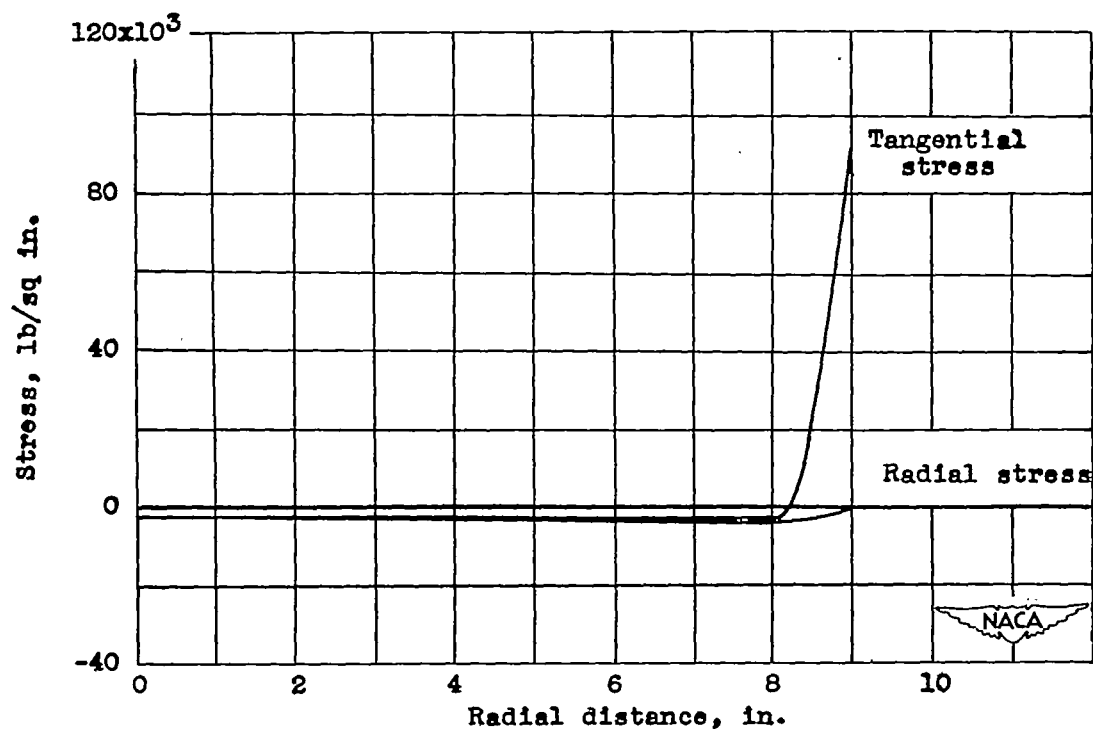


Figure 14. - Residual stresses in turbine disk upon completion of one operating cycle.

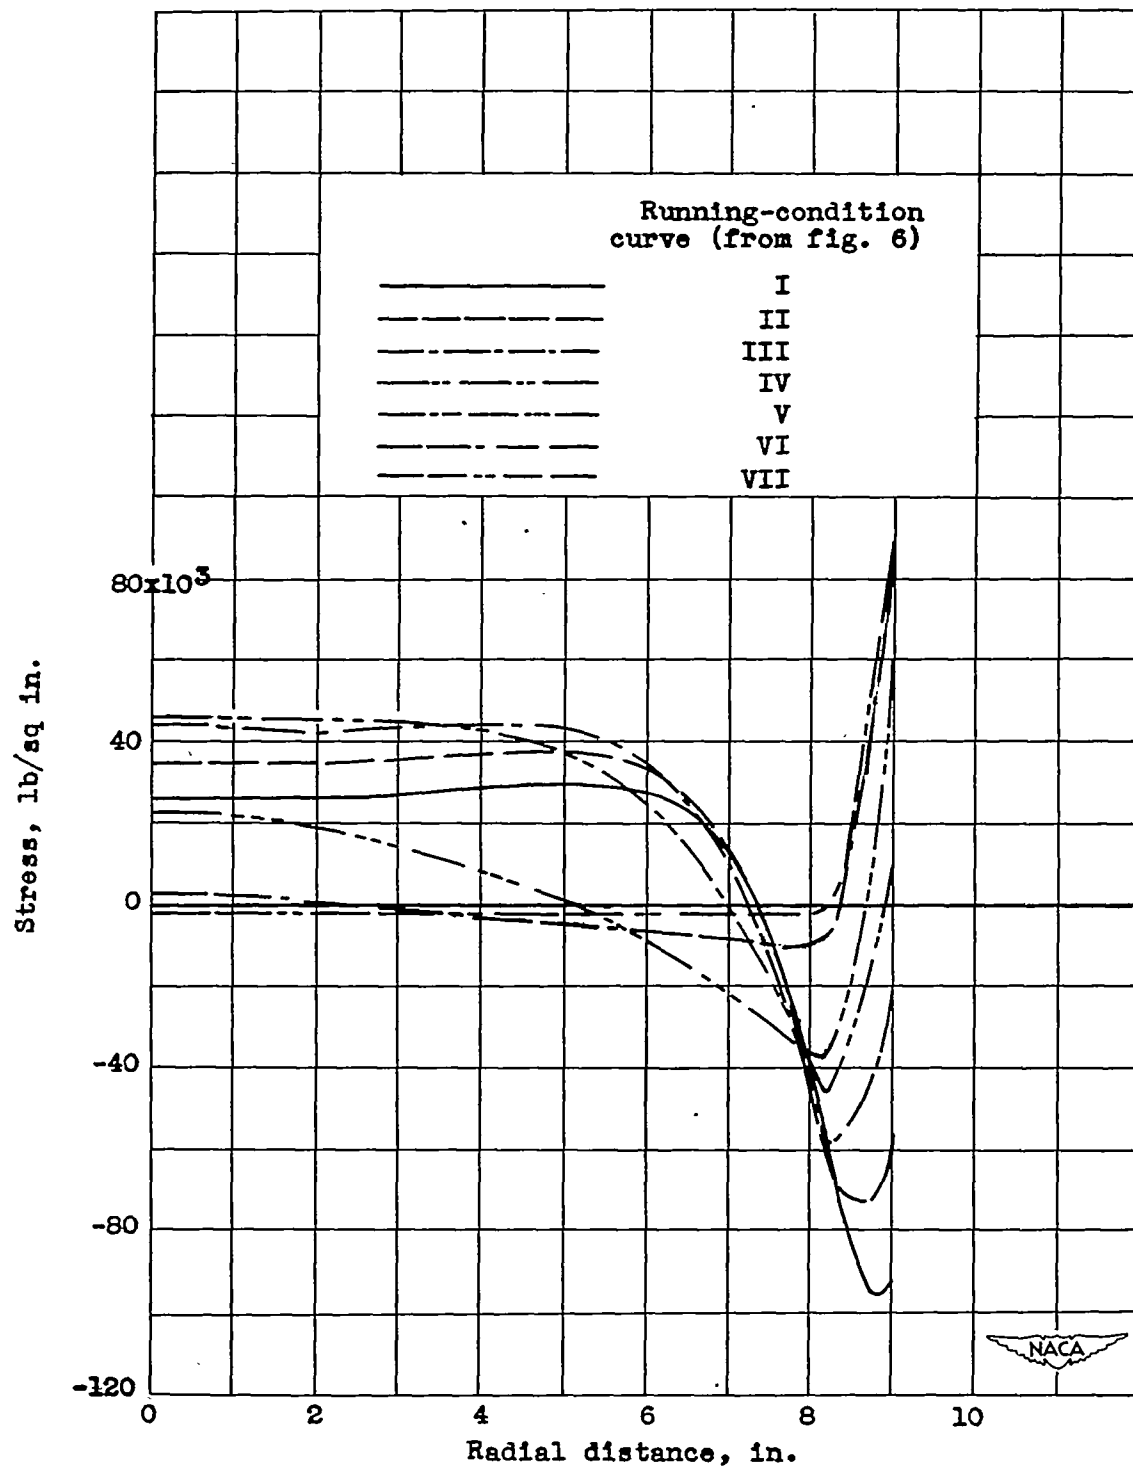


Figure 15. - Plastic tangential stresses in turbine disk during one running cycle.

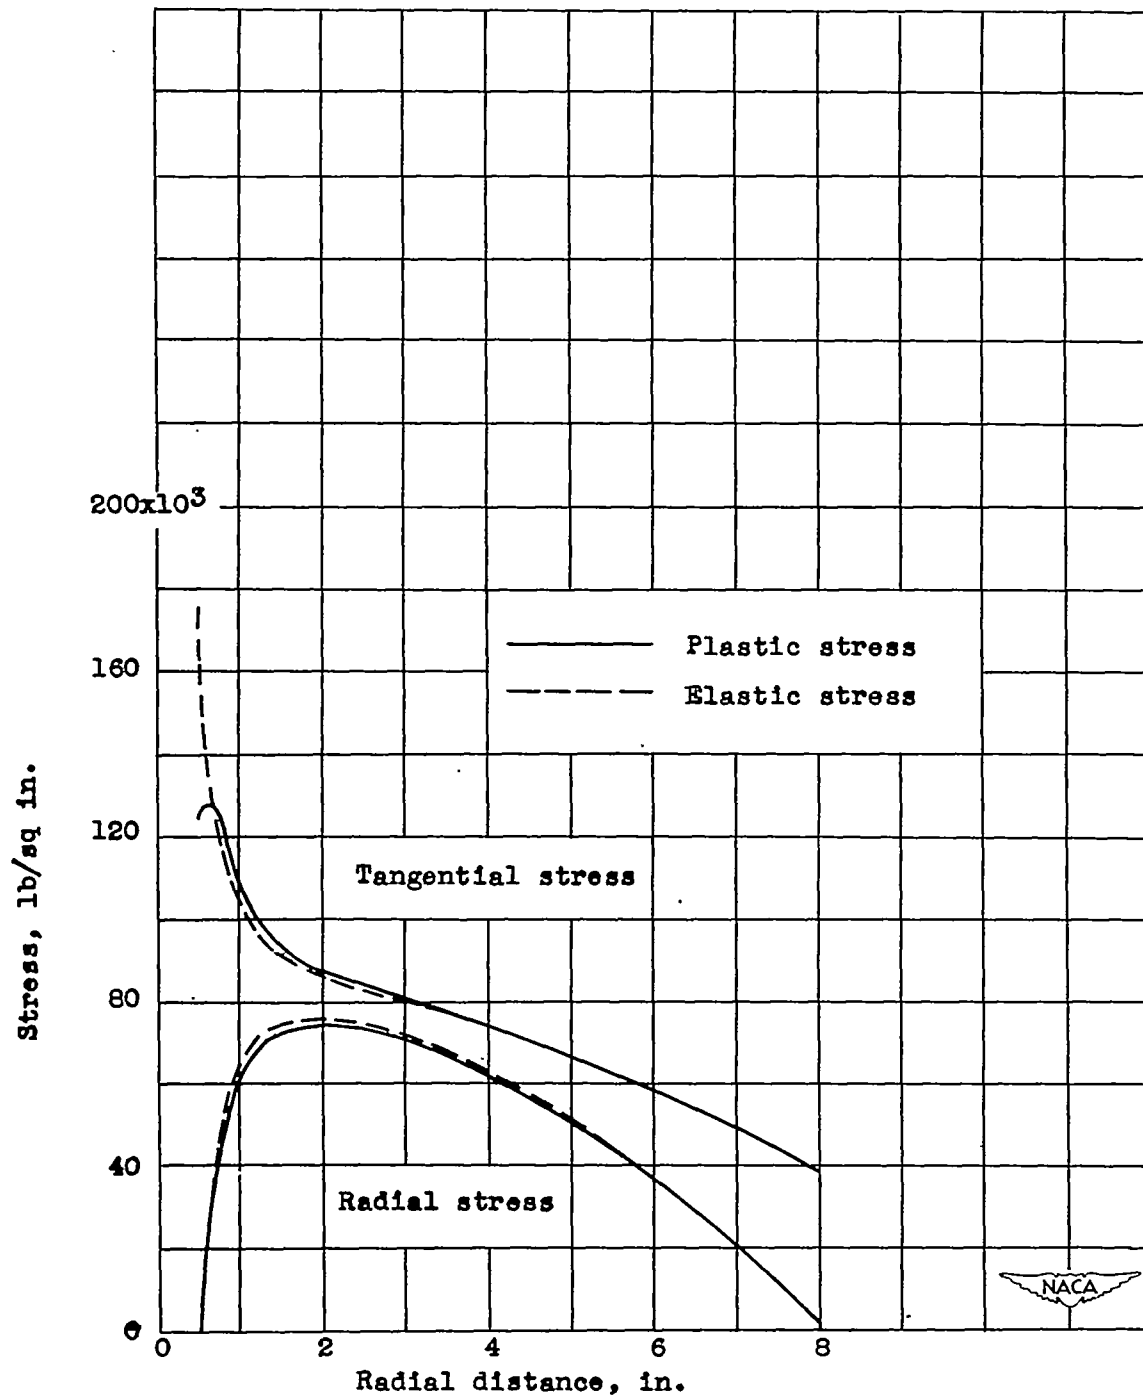


Figure 16. - Stresses in parallel-sided disk with central hole.